



NASA
Contractor Report 4644

Army Research Laboratory
Contractor Report ARL-CR-221

Generation and Computerized Simulation of Meshing and Contact of Modified Involute Helical Gears

Faydor L. Litvin, Ningxin Chen, and Jian Lu

GRANT NAG3-1469
JANUARY 1995

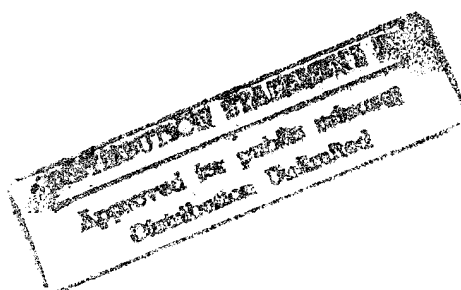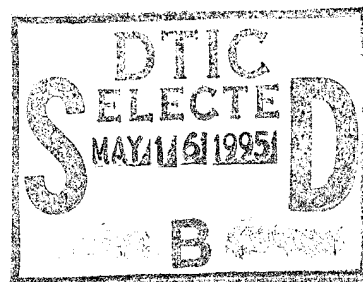

NEW QUALITY INSPECTED 8



National Aeronautics and
Space Administration



19950515 106

NASA
Contractor Report 4644

Army Research Laboratory
Contractor Report ARL-CR-221

Generation and Computerized Simulation of Meshing and Contact of Modified Involute Helical Gears

Faydor L. Litvin, Ningxin Chen, and Jian Lu
University of Illinois at Chicago
Chicago, Illinois

Prepared for
Propulsion Directorate
U.S. Army Aviation Systems Command
and
Lewis Research Center
under Grant NAG3-1469



National Aeronautics and
Space Administration

Office of Management

Scientific and Technical
Information Program

1995

GENERATION AND COMPUTERIZED SIMULATION OF MESHING AND CONTACT OF MODIFIED INVOLUTE HELICAL GEARS

by

Faydor L. Litvin

Principal Investigator

Ningxin Chen and Jian Lu

Research Associates

University of Illinois at Chicago, Chicago, IL

Abstract

The design and generation of modified involute helical gears that have a localized and stable bearing contact, and reduced noise and vibration characteristics are described. The localization of the bearing contact is achieved by the mismatch of the two generating surfaces that are used for generation of the pinion and the gear. The reduction of noise and vibration will be achieved by application of a parabolic function of transmission errors that is able to absorb the almost linear function of transmission errors caused by gear misalignment. The meshing and contact of misaligned gear drives can be analyzed by application of computer programs that have been developed. The computations confirmed the effectiveness of the proposed modification of the gear geometry. A numerical example that illustrates the developed theory is provided.

Nomenclature

a	Parabola parameter (fig. 2(a))
a_c	Modification coefficient of pinion rack-cutter surface (fig. 5)
b	Slope of linear function (fig. 1(b))
E_{pc}	The shortest distance between the pinion and rack-cutter Σ_c (fig. 6(b))
E_{pg}	The shortest distance between the pinion-gear axes (fig. 7)
E_{gt}	The shortest distance between the gear and rack-cutter Σ_t (fig. 6(a))
m_{21}	Gear ratio
M_{ij}	Coordinate transformation matrix (from S_j to S_i)
n_r	Unit normal vector to rack-cutter surface Σ_r ($r = c, t$)
$n_f^{(i)}$	Unit normal vector to surface Σ_i represented in coordinate system S_f ($i = p, g$)
N_i	Number of teeth of the pinion ($i = 1, p$) or the gear ($i = 2, g$)
N_r	Normal vector to rack-cutter surface Σ_r ($r = c, t$)
p_n	Circular pitch in normal section (fig. 3)
P_n	Diametral pitch in normal section
r_i	Radius of the pitch circle of the pinion (or gear) ($i = p, g$)
r_i, r_i^*	Position vector of surface Σ_i
$r_f^{(i)}$	Position vector of surface Σ_i represented in coordinate system S_f
s, s_r	Displacement of rack-cutter Σ_r ($r = c, t$) (fig. 6)
S_i	Coordinate system i
u_i, θ_i	Surface parameters of Σ_i ($i = p, g$)
u_r, l_r	Surface parameters of Σ_r ($r = c, t$)
$v^{(r)}$	Velocity of rack-cutter surface point ($r = c, t$)
$v^{(ij)}$	Relative velocity of surface Σ_i point with respect to surface Σ_j point
α_o	Normal pressure angle (fig. 3)
β_o	Helix angle on the pinion (gear) pitch cylinder (figs. 3 and 4)
δ	Elastic approach of pinion and gear tooth surfaces

ΔE	Change of center distance
$\Delta \lambda_o$	Change of pinion lead angle on the pitch cylinder
Δq	Displacement of contact point caused by misalignment
$\Delta \gamma_x$	Misalignment angle formed by crossed gear axes (fig. 8(a))
$\Delta \gamma_y$	Misalignment angle formed by intersected gear axes (fig. 8(b))
$\Delta \phi_2, \Delta \psi_2$	Transmission error (fig. 2)
$\Delta \phi_2$	Vector of the angle of compensating turn of gear 2
λ_o	Lead angle on pinion pitch cylinder
Σ_i	Pinion ($i = p$) and gear ($i = g$) tooth surfaces
Σ_r	Rack-cutter surfaces ($r = c, t$)
ϕ_i, ψ_i	Rotation angle of gear i ($i = 1, 2, p, g$) (figs. 2 and 7)
ψ_{gt}	Rotation angle of gear being in mesh with the rack-cutter Σ_t (fig. 6(a))
ψ_{pc}	Rotation angle of pinion being in mesh with the rack-cutter Σ_c (fig. 6(b))

Accession For	
NTIS GRA&I	<input checked="" type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification	
By	
Distribution/	
Availability Codes	
Dist	Avail and/or Special
A-1	

1. Introduction

Conventional helical involute gears are designed for transformation of rotation between parallel axes. Theoretically, the gear tooth surfaces are in line tangency at every instant, along a straight line that is a tangent to the helix on the gear base cylinder. However, the line contact of gear tooth surfaces can be realized only for an ideal gear drive. In reality, the crossing of axes of rotation (instead of being parallel) and errors of lead angle result in the so-called edge contact, as a specific instantaneous point contact caused by curve-to-surface tangency. Here, the contacting curve is the edge of the tooth surface of one of the mating gears and the contacting surface is the tooth surface of the other one.

Trying to avoid the edge contact, the manufacturers of helical gears use various methods of crowning (deviation) of the theoretical gear tooth surfaces. However, the applied methods of crowning have not been complemented with the analysis of transmission errors caused by misalignment. Our investigation shows that improper crowning may avoid edge contact but cannot avoid the appearance of transmission errors of the shape shown in fig. 1. The function of such transmission errors is piecewise, almost linear, and has the frequency equal to the cycle of meshing of one pair of teeth. The above mentioned transmission errors cause high vibration and noise and therefore such transmission errors must be avoided. This can be achieved by application of computer numerically controlled (CNC) machines that have opened new perspectives for generation of gear tooth surfaces with improved topology.

The intent of this paper is to describe a modified topology of low-noise involute helical gears that satisfies the following requirements:

- (1) The noise and vibration of helical gears are reduced substantially by application of a predesigned function of transmission errors of a parabolic type (fig. 2). Such a function can absorb (see below) an almost linear function of transmission errors shown in fig. 1.

- (2) The bearing contact is localized. Theoretically, the tooth surfaces are in tangency at every instant at a point instead of a line. The contact of gear tooth surfaces at every instant

is spread over an elliptical area due to elastic deformation of gear teeth. The dimension of the instantaneous contact ellipse can be controlled by choosing proper design parameters.

(3) The proposed gear tooth surfaces can be generated by two rack-cutters designed for generation of the pinion and gear, respectively. A nonlinear transmission function in the process for gear generation must be provided and this can be accomplished by application of the CNC machine. A linear transmission function is provided in the process for the pinion generation.

2. Interaction of Parabolic and Linear Function of Transmission Errors

The ideal gears transform rotation with constant gear ratio $m_{21} = \frac{N_1}{N_2}$, and the ideal transmission function is

$$\phi_2^o(\phi_1) = \frac{N_1}{N_2} \phi_1 \quad (1)$$

where N_1 and N_2 are the tooth numbers of the pinion and gear, respectively.

However, the crossing of gear axes (instead of being parallel), intersection of these axes and errors of lead angle cause a transmission function $\phi_2(\phi_1)$ that is shown in fig. 1(a). Our investigation (see sections 4-6) shows that the function of transmission errors caused by above mentioned errors of misalignment is a piecewise almost linear function of transmission errors $\Delta\phi_2(\phi_1)$ with the frequency of a cycle of meshing for one pair of teeth (fig. 1(b)).

Here:

$$\Delta\phi_2(\phi_1) = \phi_2(\phi_1) - \frac{N_1}{N_2} \phi_1 \quad (2)$$

Transmission errors of this type cause a discontinuity of the transmission function and a

big jump of the angular velocity of the driven gear at transfer points (when one pair of teeth is changed to another one). Therefore, vibration and noise become inevitable.

It was proven [1,2,4] that a predesigned parabolic function of transmission errors interacting with a linear function will become a parabolic function with the same parabola parameter. A parabolic function of transmission errors is much more preferable than a linear function since the transmission function will be a continuous one, the jump of angular velocity of the driven gear and the stroke at the transfer point will be substantially reduced.

Fig. 2(a) shows the sum of two functions of transmission errors

$$\Delta\phi_2(\phi_1) = \Delta\phi_2^{(1)}(\phi_1) + \Delta\phi_2^{(2)}(\phi_1) = b\phi_1 - a\phi_1^2 \quad (3)$$

The first one, $\Delta\phi_2^{(1)}(\phi_1)$, is caused by misalignment. The second one, $\Delta\phi_2^{(2)}(\phi_1)$, is a predesigned parabolic function which exists even if misalignment does not appear. It is easy to verify that equation (3) represents in the new coordinate system $(\Delta\psi_2, \psi_1)$ the parabolic function (fig. 2(b)) that is designated as

$$\Delta\psi_2 = -a\psi_1^2 \quad (4)$$

The parabola parameter a in equations (3) and (4) is the same. Axes of coordinate system $(\Delta\psi_2, \psi_1)$ and $(\Delta\phi_2, \phi_1)$ are parallel but the origins are different. The coordinate transformation from $(\Delta\phi_2, \phi_1)$ to $(\Delta\psi_2, \psi_1)$ is represented with the following equations

$$\Delta\psi_2 = \Delta\phi_2 - \frac{b^2}{4a}, \quad \psi_1 = \phi_1 - \frac{b}{2a} \quad (5)$$

The difference between functions $\Delta\phi_2(\phi_1)$ and $\Delta\psi_2(\psi_1)$ is the location of the couple of points (A, B) and the respective points (A^*, B^*) (fig. 2(a)). The symmetrical location of (A, B) is turned into the asymmetrical location of (A^*, B^*) . However, the interaction of several functions $\Delta\psi_2(\psi_1)$ determined for several tooth surfaces being in mesh may provide a symmetrical parabolic function of transmission errors as shown in fig. 2(b). This can be achieved if the parabolic function $\Delta\phi_2(\phi_1)$ will be predesigned in the area (fig. 2(a))

$$\phi_1(B) - \phi_1(A) \geq \frac{2\pi}{N_1} + 2c \quad (6)$$

where $c = \frac{b}{2a}$. Requirement (6), if observed, enables to provide a continuous function $\Delta\psi_2(\psi_1)$ for the range of $\frac{2\pi}{N_1}$ where N_1 is the pinion tooth number. It will be shown below (see sections 5 and 6) that functions of transmission errors caused by angular errors (such as the crossing and intersection of the axes of rotation, error of the lead angles) are indeed piecewise linear functions, and the coefficient b can be determined knowing the angular error caused by misalignment and the design parameters of the gear drive.

3. Surfaces of Rack-Cutters

The imaginary process of generation of conjugate tooth surfaces is based on application of two rack-cutters that are provided respectively by a plane Σ_t and a cylindrical surface Σ_c that differs slightly from plane Σ_t (see fig. 3). The rack-cutter surfaces Σ_t and Σ_c are rigidly connected each to other in the process of the imaginary generation, and they are in tangency along a straight line, $O_b z_b$ (fig. 5). This line and the parallel axes of the gears form angle β_o , that is equal to the helix angle on the pinion (gear) pitch cylinder. The normal sections of the rack-cutters are shown in figs. 3 and 5. Rack-cutter surface Σ_c generates the pinion tooth surface Σ_p , and the rack-cutter surface Σ_t generates the gear tooth surface Σ_g .

Gear Rack-Cutters Σ_t

Using figs. 3, 4 and 5, we represent the transformation matrix from system S_a to S_r ($r = c, t$) and S_b to S_a as follows

$$M_{ra} = \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & \cos \beta_o & \sin \beta_o & 0 \\ 0 & -\sin \beta_o & \cos \beta_o & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix} \quad (7)$$

$$M_{ab} = \begin{bmatrix} \cos \alpha_o & -\sin \alpha_o & 0 & -d_p \cos \alpha_o \\ \sin \alpha_o & \cos \alpha_o & 0 & a_m - d_p \sin \alpha_o \\ 0 & 0 & 1 & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix} \quad (8)$$

$$M_{rb} = \begin{bmatrix} \cos \alpha_o & -\sin \alpha_o & 0 & -d_p \cos \alpha_o \\ \sin \alpha_o \cos \beta_o & \cos \alpha_o \cos \beta_o & \sin \beta_o & (a_m - d_p \sin \alpha_o) \cos \beta_o \\ -\sin \alpha_o \sin \beta_o & -\cos \alpha_o \sin \beta_o & \cos \beta_o & -(a_m - d_p \sin \alpha_o) \sin \beta_o \\ 0 & 0 & 0 & 1 \end{bmatrix} \quad (9)$$

Here α_o and β_o are the normal pressure angle and the helix angle of the rack-cutter; a_m is the half of the tooth width of the rack-cutter on middle line $m - m$ (fig. 3), where

$$a_m = \frac{\pi}{4P_n} \quad (10)$$

and P_n is the normal diametral pitch of the rack-cutter, d_p is the distance between middle line $m - m$ of the rack-cutter and the origin O_b along axis x_b , fig. 5. Parameter d_p can be controlled to adjust the location of the contact path on the gear tooth surface.

Surface Σ_t of the gear rack-cutter is a plane that is represented in S_b as

$$\mathbf{r}_t^{(b)} = \begin{bmatrix} u_t & 0 & l_t \end{bmatrix}^T \quad (11)$$

where (u_t, l_t) are the surface parameters.

Rack-cutter surface Σ_t is represented in coordinate system S_t by the matrix equation

$$\mathbf{r}_t(u_t, l_t) = \mathbf{M}_{tb} \mathbf{r}_t^{(b)} \quad (12)$$

Equations (9), (11) and (12) yield

$$\mathbf{r}_t = \begin{bmatrix} (u_t - d_p) \cos \alpha_o \\ [(u_t - d_p) \sin \alpha_o + a_m] \cos \beta_o + l_t \sin \beta_o \\ - [(u_t - d_p) \sin \alpha_o + a_m] \sin \beta_o + l_t \cos \beta_o \end{bmatrix} \quad (13)$$

The unit normal to Σ_t is represented in S_t by equations

$$\mathbf{n}_t = \frac{\mathbf{N}_t}{|\mathbf{N}_t|}, \quad \mathbf{N}_t = \frac{\partial \mathbf{r}_t}{\partial l_t} \times \frac{\partial \mathbf{r}_t}{\partial u_t} \quad (14)$$

that yield

$$\mathbf{n}_t = \begin{bmatrix} -\sin \alpha_o & \cos \alpha_o \cos \beta_o & -\cos \alpha_o \sin \beta_o \end{bmatrix}^T \quad (15)$$

Pinion Rack-Cutter Surface Σ_c

Rack-cutter Σ_c generates the pinion. The normal section of rack-cutter surface Σ_c (fig. 5) is a parabolic curve. We remind that the normal section of rack-cutter surface Σ_t is a straight line directed along axis x_b in fig. 5. The parabolic curve is in tangency with the x_b -axis at point $N(O_b)$. Rack-cutter surfaces Σ_c and Σ_t are in tangency along a straight line that is parallel to axes z_a and z_b and passes through point O_b that coincides with point N . The deviation of the parabolic curve from the x_b -axis affects the dimensions of the instantaneous contact ellipse.

Rack-cutter surface Σ_c is represented in S_b as follows

$$\mathbf{r}_c^{(b)} = \begin{bmatrix} u_c & -a_c u_c^2 & l_c \end{bmatrix}^T \quad (16)$$

where a_c is coefficient of the parabolic normal section, and (u_c, l_c) are the surface parameters of Σ_c .

Rack-cutter surface Σ_c is represented in coordinate system S_c by the matrix equation

$$\mathbf{r}_c(u_c, l_c) = \mathbf{M}_{cb} \mathbf{r}_c^{(b)} \quad (17)$$

Equations (9), (16) and (17) yield

$$\mathbf{r}_c = \begin{bmatrix} (u_c - d_p) \cos \alpha_o + a_c u_c^2 \sin \alpha_o \\ [(u_c - d_p) \sin \alpha_o + a_m] \cos \beta_o - a_c u_c^2 \cos \alpha_o \cos \beta_o + l_c \sin \beta_o \\ -[(u_c - d_p) \sin \alpha_o + a_m] \sin \beta_o + a_c u_c^2 \cos \alpha_o \sin \beta_o + l_c \cos \beta_o \end{bmatrix} \quad (18)$$

The unit normal of Σ_c is represented as

$$\mathbf{n}_c = \frac{\frac{\partial \mathbf{r}_c}{\partial u_c} \times \frac{\partial \mathbf{r}_c}{\partial l_c}}{\left| \frac{\partial \mathbf{r}_c}{\partial u_c} \times \frac{\partial \mathbf{r}_c}{\partial l_c} \right|} \quad (19)$$

Equations (18) and (19) yield

$$\mathbf{n}_c = \frac{1}{(1 + 4a_c^2 u_c^2)^{0.5}} \begin{bmatrix} \sin \alpha_o - 2a_c u_c \cos \alpha_o \\ -(\cos \alpha_o + 2a_c u_c \sin \alpha_o) \cos \beta_o \\ (\cos \alpha_o + 2a_c u_c \sin \alpha_o) \sin \beta_o \end{bmatrix} \quad (20)$$

Using equations (13), (15), (18) and (20), it is easy to verify that surfaces Σ_c and Σ_t are in tangency along the z_b axis when $u_c = u_t = 0$.

4. Pinion and Gear Surfaces Generated by Rack-Cutters

In the process for generation the two rigidly connected rack-cutters perform translational motion while the pinion and the gear perform rotational motions as shown in fig. 6. To provide a predesigned parabolic function of transmission errors for each cycle of meshing, it is necessary to observe certain relations between the motions of the rack-cutters and gears, respectively.

The angle ψ_{pc} of pinion rotation and the displacement s_c of rack-cutter Σ_c are related by the following linear function

$$\psi_{pc} = \frac{s_c}{r_p} \quad (21)$$

Here: r_p is the radius of the pinion pitch cylinder.

The angle ψ_{gt} of gear rotation and the displacement s_t of rack-cutter Σ_t are related as follows

$$\psi_{gt} = \frac{N_p}{N_g} \left(\frac{s_t}{r_p} \right) - a \left(\frac{s_t}{r_p} - \psi^{(0)} \right)^2 \quad (22)$$

Here: N_p and N_g are the tooth numbers of the pinion and gear, respectively, and $\psi^{(0)}$ is the initial position angle of the gear for the modification gear rotation.

Equation of Meshing between Rack-Cutter Σ_c and Pinion Σ_p

The equation of meshing between rack-cutter Σ_c and the pinion tooth surface Σ_p is represented as

$$f(u_c, l_c, \psi_{pc}) = \mathbf{N}_c^{(c)} \cdot \mathbf{v}_c^{(cp)} = 0 \quad (23)$$

where ψ_{pc} is the angle of rotation of the pinion in the process for generation. The normal $\mathbf{N}_c^{(c)}$ to Σ_c in S_c can be obtained by equation (20), and the relative velocity of the pinion with respect to Σ_c may be represented as

$$\mathbf{v}_c^{(pc)} = \boldsymbol{\omega}_c^{(p)} \times (\mathbf{R}_p + \mathbf{r}_c) - (0 \ r_p \ 0)^T \frac{d\psi_{pc}}{dt} \quad (24)$$

Here: $\mathbf{R}_p = (\overline{O_p O_c})_c = (r_p \ r_p \psi_{pc} \ 0)^T$, $r_p = E_{pc}$ is the radius of the pitch cylinder of the pinion (fig. 6), $\boldsymbol{\omega}_c^{(p)} = \omega_c^{(p)} (0 \ 0 \ 1)^T$.

Substitution of equations (19) and (24) into (23), yields the following equation of meshing between Σ_p and Σ_c

$$f(u_c, l_c, \psi_{pc}) = l_c \sin \beta_o + r_p \psi_{pc} + a_m \cos \beta_o + \frac{[(u_c - d_p) + 2a_c^2 u_c^3] \cos \beta_o}{\sin \alpha_o - 2a_c u_c \cos \alpha_o} = 0 \quad (25)$$

Surface of Pinion Σ_p

In the process of generation of pinion surface, rack-cutter Σ_c performs uniform translation and the workpiece performs uniform rotation (fig. 6(b)). The transformation matrix from system S_c to S_p can be represented as

$$\mathbf{M}_{pc} = \begin{bmatrix} \cos \psi_{pc} & \sin \psi_{pc} & 0 & r_p \cos \psi_{pc} + r_p \psi_{pc} \sin \psi_{pc} \\ -\sin \psi_{pc} & \cos \psi_{pc} & 0 & -r_p \sin \psi_{pc} + r_p \psi_{pc} \cos \psi_{pc} \\ 0 & 0 & 1 & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix} \quad (26)$$

Pinion surface Σ_p in system S_p is represented as

$$\left. \begin{aligned} \mathbf{r}_p(u_c, l_c, \psi_{pc}) &= \mathbf{M}_{pc} \mathbf{r}_c \\ l_c &= -\left\{ \frac{(u_c - d_p) + 2a_c^2 u_c^3}{\sin \alpha_o - 2a_c u_c \cos \alpha_o} \cos \beta_o + r_p \psi_{pc} + a_m \cos \beta_o \right\} / \sin \beta_o \end{aligned} \right\} \quad (27)$$

Substituting equation (26) into (27), we obtain equation of Σ_p as

$$\mathbf{r}_p(u_c, \psi_{pc}) = \mathbf{r}_p(u_p, \theta_p) \quad (28)$$

Equation of Meshing between Rack-Cutter Σ_t and Gear Σ_g

The equation of meshing between rack-cutter Σ_t and the gear tooth surface Σ_g is represented as

$$f(u_t, l_t, \psi_{gt}) = \mathbf{n}_t^{(t)} \cdot \mathbf{v}_t^{(gt)} = 0 \quad (29)$$

where ψ_{gt} is the angle of rotation of the gear in the process for generation. The unit normal $\mathbf{n}_t^{(t)}$ to Σ_t in S_t is represented by equation (15), and $\mathbf{v}_t^{(gt)}$ is the relative velocity of the gear with respect to rack-cutter Σ_t .

We recall that the rack-cutter Σ_t performs translation with constant velocity, but the gear performs rotation with variable angular velocity that is represented as (see equation (22))

$$\boldsymbol{\omega}_t^{(g)} = \begin{bmatrix} 0 & 0 & -[\frac{N_p}{N_g} - 2a(\psi_{pc} - \psi^{(0)})] \end{bmatrix}^T \frac{d\psi_{pc}}{dt} \quad (30)$$

The relative velocity $\mathbf{v}_t^{(gt)}$ is represented as

$$\mathbf{v}_t^{(gt)} = \boldsymbol{\omega}_t^{(g)} \times (\mathbf{R}_g + \mathbf{r}_t) - (0 \quad \frac{N_p}{N_g} r_g \quad 0)^T \frac{d\psi_{pc}}{dt} \quad (31)$$

where

$$\mathbf{R}_g = \begin{pmatrix} -r_g & \frac{N_p}{N_g} r_g \psi_{pc} & 0 \end{pmatrix}^T \quad (32)$$

and $r_g = E_{gt}$ is the radius of pitch cylinder of the gear (fig. 6).

Substitution of equations (15), (30), (31) and (32) into (29) yields the following equation of meshing between Σ_g and Σ_t

$$\begin{aligned} f(u_t, l_t, \psi_{gt}) &= (u_t - d_p) \cos \beta_o + \sin \alpha_o (l_t \sin \beta_o + \frac{N_p}{N_g} r_g \psi_{pc} + a_m \cos \beta_o) \\ &+ \frac{2aN_g r_g (\psi_{pc} - \psi^{(0)})}{N_p - 2aN_g (\psi_{pc} - \psi^{(0)})} \cos \alpha_o \cos \beta_o \end{aligned} \quad (33)$$

where

$$\psi_{gt} = \frac{N_p}{N_g} \psi_{pc} - a(\psi_{pc} - \psi^{(0)})^2 \quad (34)$$

Surface of Gear Σ_g

It must be remembered that the gear with the tooth surface Σ_g performs rotation about its axis with varied angular velocity while rack-cutter Σ_t performs uniform translation (fig. 6(a)). The transformation matrix from system S_t to S_g can be represented as

$$\mathbf{M}_{gt} = \begin{bmatrix} -\cos \psi_{gt} & \sin \psi_{gt} & 0 & r_g \cos \psi_{gt} + r_g \frac{N_p}{N_g} \psi_{pc} \sin \psi_{gt} \\ -\sin \psi_{gt} & -\cos \psi_{gt} & 0 & r_g \sin \psi_{gt} - r_g \frac{N_p}{N_g} \psi_{pc} \cos \psi_{gt} \\ 0 & 0 & 1 & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix} \quad (35)$$

Gear tooth surface Σ_g in system S_g can be represented as

$$\left. \begin{aligned} \mathbf{r}_g(u_t, l_t, \psi_{gt}) &= \mathbf{M}_{gt} \mathbf{r}_t \\ l_t &= -\{(u_t - d_p) \frac{\cot \beta_o}{\sin \alpha_o} + (\frac{N_p}{N_g} r_g \psi_{pc} + a_m \cos \beta_o) \frac{1}{\sin \beta_o} \\ &\quad + \frac{2aN_g r_g (\psi_{pc} - \psi^{(0)})}{N_p - 2aN_g (\psi_{pc} - \psi^{(0)})} \cot \alpha_o \cot \beta_o\} \end{aligned} \right\} \quad (36)$$

The derivation of equation (36) is based on transformation of equations (33) and (34). Equations (35) and (36) enable to represent the gear tooth surface in two-parameter form as follows

$$\mathbf{r}_g(u_t, \psi_{gt}) = \mathbf{r}_g(u_g, \theta_g) \quad (37)$$

5. Computerized Simulation of Meshing and Contact of Pinion-Gear Tooth Surfaces

We consider that the surfaces of the pinion and the gear generated by worms Σ_w and Σ_h are represented in coordinate systems S_p and S_g , respectively. The fixed coordinate system S_f

is rigidly connected to the housing of the gear drive (figs. 7 and 8). The movable coordinate systems S_p and S_g are rigidly connected to the pinion and the gear, respectively. An auxiliary coordinate system S_h is applied for simulation of meshing when the gear axis is crossed or intersected with the pinion axis instead of being parallel, and when the shortest distance between the pinion and gear axes is changed. The errors of misalignment are referred to the gear. The misalignment angle $\Delta\gamma$ is decomposed into two components, $\Delta\gamma_x$ and $\Delta\gamma_y$ that represent the crossing angle and the intersection angle, respectively. The pinion performs rotational motion about the z_f -axis. The axis of gear rotation is z_h . The shortest distance between the axes of rotation is designated as E_{pg} .

The rotation matrices from system S_h to S_f for crossed and intersecting angles are represented in the followings (fig. 8)

$$L_{fh} = \begin{bmatrix} -1 & 0 & 0 \\ 0 & -\cos \Delta\gamma_x & \sin \Delta\gamma_x \\ 0 & \sin \Delta\gamma_x & \cos \Delta\gamma_x \end{bmatrix} \quad (38)$$

$$L_{fh} = \begin{bmatrix} -\cos \Delta\gamma_y & 0 & -\sin \Delta\gamma_y \\ 0 & -1 & 0 \\ -\sin \Delta\gamma_y & 0 & \cos \Delta\gamma_y \end{bmatrix} \quad (39)$$

We represent the pinion and gear tooth surfaces, Σ_p and Σ_g , and their unit normals in coordinate system S_f . The conditions of continuous tangency of surfaces Σ_p and Σ_g are represented by the following equations [1,2].

$$\mathbf{r}_f^{(p)}(u_p, \theta_p, \phi_p) = \mathbf{r}_f^{(g)}(u_g, \theta_g, \phi_g) \quad (40)$$

$$\mathbf{n}_f^{(p)}(u_p, \theta_p, \phi_p) = \mathbf{n}_f^{(g)}(u_g, \theta_g, \phi_g) \quad (41)$$

Vector equation (41) provides only two independent equations since $|\mathbf{n}_f^{(p)}| = |\mathbf{n}_f^{(g)}| = 1$. The total number of independent equations provided by (40) and (41) is five that relate six parameters

$$f_i(u_p, \theta_p, \phi_p, u_g, \theta_g, \phi_g) = 0 \quad (i = 1, 2, \dots, 5) \quad (42)$$

The continuous solution of the system of nonlinear equations (42) is based on the following procedure:

(1) Using an initial guess, we determine a set of parameters that satisfy equation system (42). Thus

$$P^{(0)} = (u_p^{(0)}, \theta_p^{(0)}, u_g^{(0)}, \theta_g^{(0)}, \phi_g^{(0)}) \quad (43)$$

(2) One of the variable parameters, say ϕ_p , is chosen as the input one, and is supposed that the Jacobian

$$\frac{D(f_1, f_2, f_3, f_4, f_5)}{D(u_p, \theta_p, u_g, \theta_g, \phi_g)} \quad (44)$$

differs from zero. The derivatives in the Jacobian are taken at point $P^{(0)}$.

(3) Then, equation system (42) can be solved in the neighborhood of $P^{(0)}$ by functions

$$\phi_g(\phi_p), u_p(\phi_p), \theta_p(\phi_p), u_g(\phi_p), \theta_g(\phi_p) \quad (45)$$

(4) Vector function $\mathbf{r}_p(u_p, \theta_p)$ that determines the pinion surface Σ_p and functions $u_p(\phi_p)$, $\theta_p(\phi_p)$ enable to determine the path of contact on Σ_p .

(5) Similarly, we can obtain the path of contact on the gear surface Σ_g using vector function $\mathbf{r}_g(u_g, \theta_g)$ and functions $u_g(\phi_p)$, $\theta_g(\phi_p)$.

(6) The paths of contact on pinion and gear tooth surfaces slightly deviate from helices in the case of an aligned gear drive. The line of action for an aligned gear drive (the set of contact points in S_f) slightly deviates from a straight line that is parallel to the gear axes.

(7) The transmission function $\phi_g(\phi_p)$ deviates from the ideal transmission function, and the function of transmission errors coincides with the predesigned parabolic function.

(8) The determination of dimensions and orientation of the instantaneous contact ellipse needs the knowledge of the principal curvatures and directions of contacting surfaces and the elastic approach of surfaces. This problem can be substantially simplified if the pinion-gear principal curvatures and directions are expressed in terms of the principal curvatures and directions of the generating surfaces and parameters of motion [1,2].

6. Numerical Example

The method developed in this report is illustrated with the example discussed below. The design parameters of the pinion and gear are listed in Table 1. The numerical simulation of meshing is performed for an aligned and misaligned gear drives with various errors of alignment for the pinion and gear.

Case 1. Aligned gear drive

Figure 9 shows the transmission errors for the aligned gear drive. The TCA performed

Table 1: Design parameters of pinion and gear

	pinion	gear
tooth number	$N_p = 20$	$N_g = 100$
normal diametral pitch	$P_n = 5 \frac{1}{in}$	$P_n = 5 \frac{1}{in}$
normal pressure angle	$\alpha_o = 20^\circ$	$\alpha_o = 20^\circ$
helix angle on pitch cylinder	$\beta_o = 30^\circ$	$\beta_o = 30^\circ$
tooth length	$L = 1.6 \text{ in.}$	$L = 1.6 \text{ in.}$
modification coefficient	$a_c = 0.0008$	$a = 0.0014$
elastic approach	$\delta = 0.007 \text{ mm.}$	$\delta = 0.007 \text{ mm.}$

confirms that the predesigned parabolic function of transmission errors exists. The maximum transmission error is approximately 8 arc seconds. Figure 10 shows the contact pattern and the contact path. The path of contact on the tooth surface is in the longitudinal direction. The major axis of the instantaneous contact ellipse is 6 mm for the assumed elastic approach of the surfaces equal to 0.007 mm.

Case 2. The pinion-gear rotation axes are crossed

Figures 11 and 12 show the transmission errors and the contact pattern for the case when the crossing angle $\Delta\gamma_{cross}$ is 4 arc minutes. The maximum transmission error is 8 arc seconds and contact paths are shifted up and down on the gear and pinion surfaces, respectively. Figures 13 and 14 show the transmission errors and contact pattern for $\Delta\gamma_{cross} = -4$ arc minutes.

Case 3. The pinion-gear rotation axes are intersected

Figures 15 and 16 show the transmission errors for the misalignment $\Delta\gamma_{intersect} = 4$ arc minutes. Figures 17 and 18 show the transmission errors and contact pattern for the mentioned above error of alignment.

Case 4. Influence of error of lead angle

Figures 19 and 20 show the transmission errors and contact pattern when the error of the lead angle is 4 arc minutes.

Figures 21 and 22 show the transmission errors and contact pattern when the error of the lead angle is -4 arc minutes.

For all of above cases, the maximum transmission error does not exceed 8 arc second (with very small deviations of this value).

7. Conclusion

From the analytical study presented in this report the following conclusions can be drawn:

- (1) The interaction of a parabolic and a linear functions of transmission errors has been discussed to prove the possibility to absorb almost, linear functions of transmission errors caused by misalignment.
- (2) Mismatched surfaces of two rack-cutters for generation of modified involute gears have been proposed.
- (3) Generation and geometry of pinion-gear modified tooth surfaces have been determined.
- (4) Computerized simulation of meshing and contact of pinion-gear tooth surfaces has been developed.
- (5) An algorithm for determination of relations between the curvatures of the generating and the generated surfaces has been developed.
- (6) An algorithm for determination of the contact ellipse has been developed.
- (7) Directions for users of application of developed computer programs for the design of gears with the modified geometry and computerized simulation of their meshing and contact have been developed (Appendix C).

References

1. Litvin, F.L.: "Theory of Gearing", NASA Publication 1212, 1989.
2. Litvin, F.L.: "Gear Geometry and Applied Theory", Prentice Hall, Englewood Cliffs, New Jersey, 1994.
3. Litvin, F.L. and Krylov, N.N. and Erichov, M.L.: "Generation of Tooth Surfaces by Two-Parameter Enveloping", *Mechanism and Machine Theory*, 1975, Vol.10, pp. 365-373.
4. Litvin, F.L. and Zhang, J., Handschuh, R.F. and Coy, J.J.: "Topology of Modified Helical Gears", *Surface Topology*, p.p. 41-58, March, 1989.
5. Reishauer CNC Gear Grinding Machines, Catalogs, Switzerland.




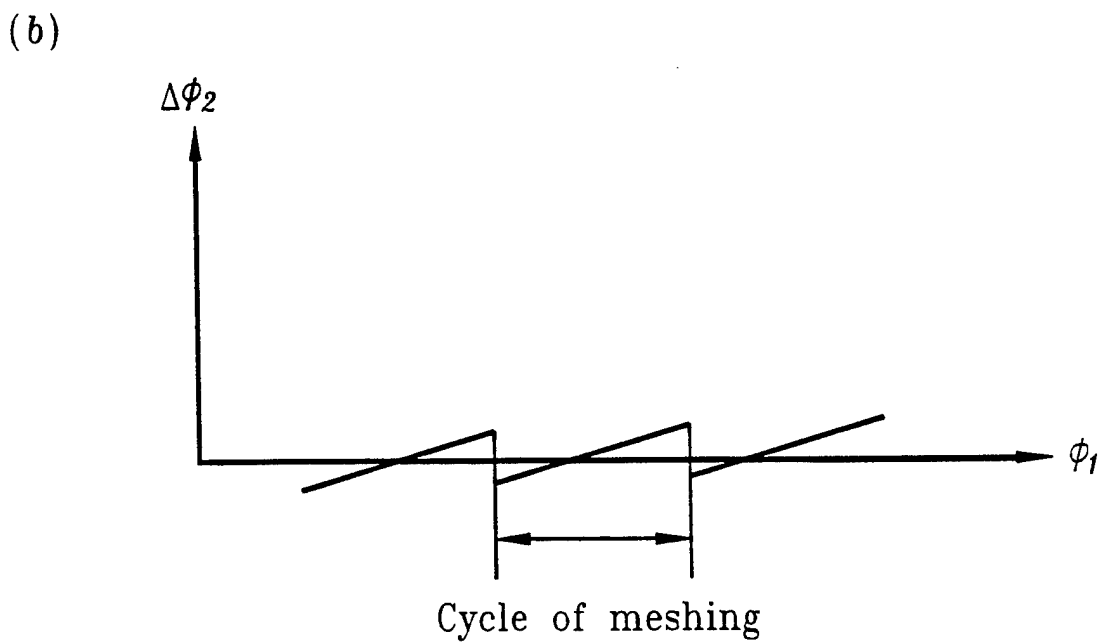


Fig. 1 Transmission function and transmission errors for a misaligned gear drive

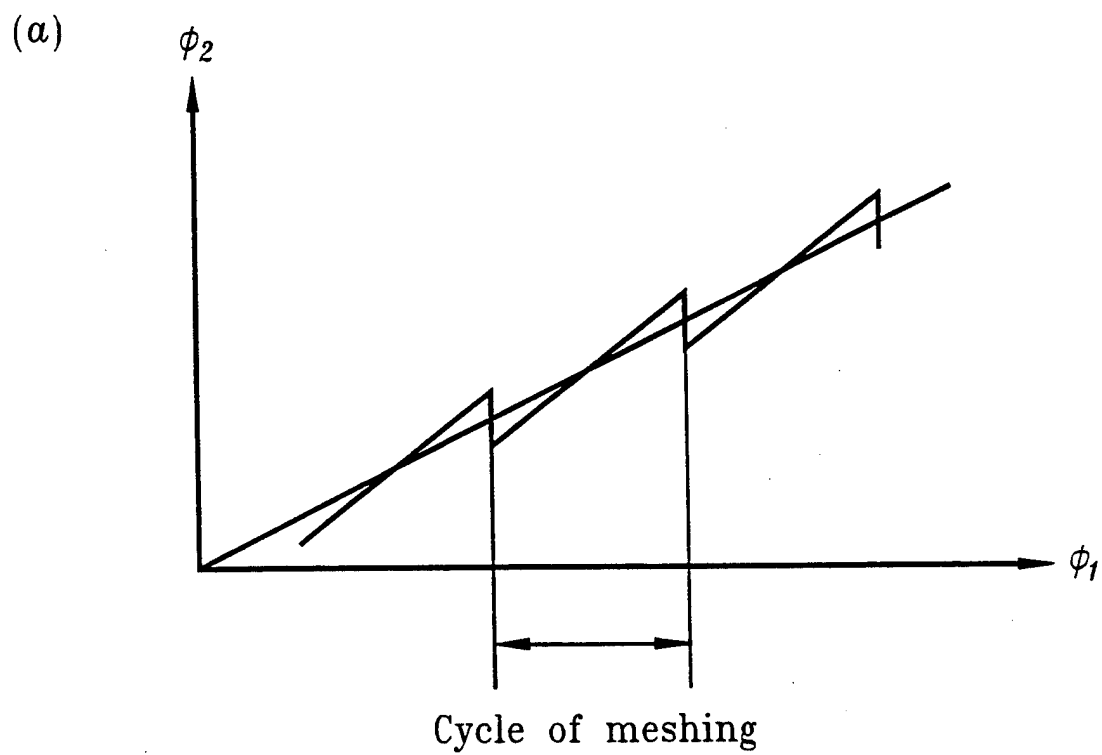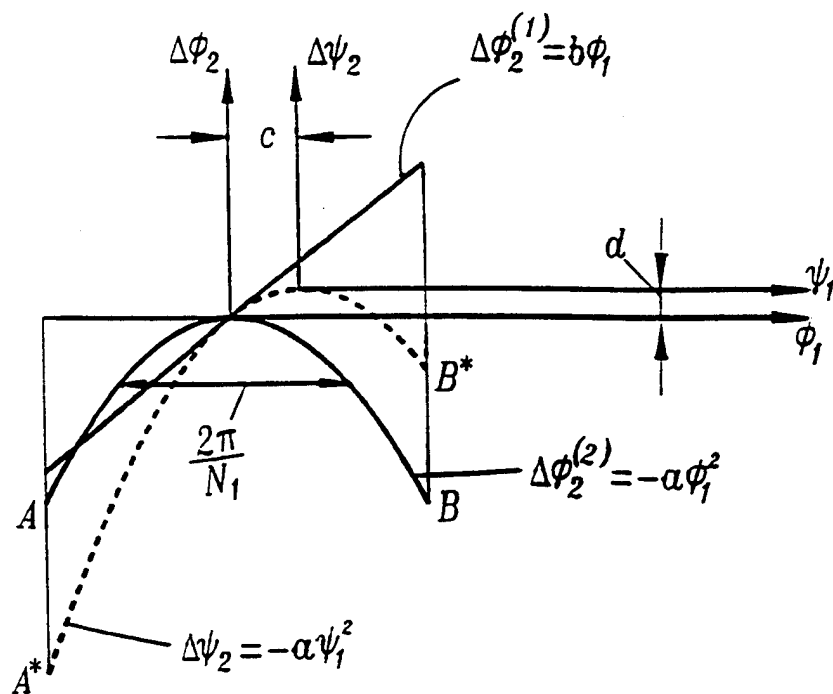


(a)

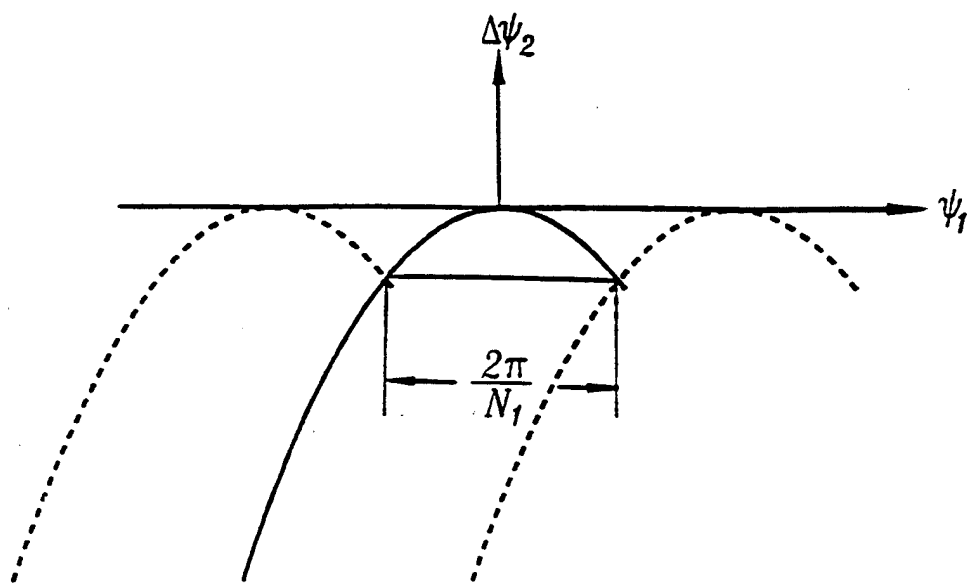


(b)

Fig. 2 Interaction of parabolic and linear functions

(a)

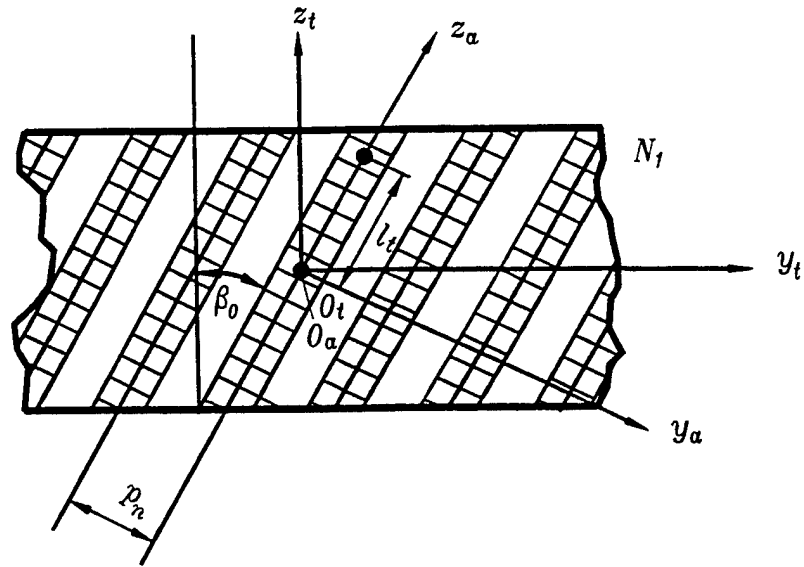

(b)

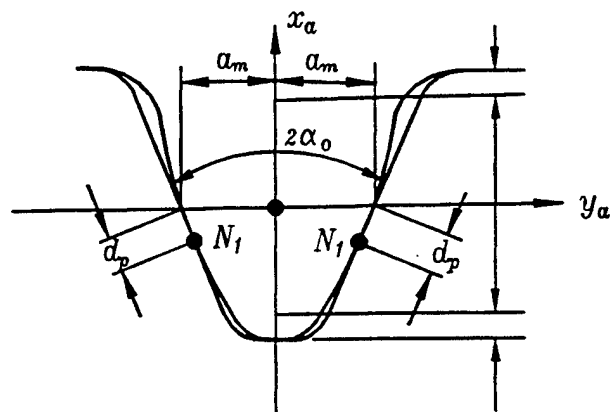

(c)

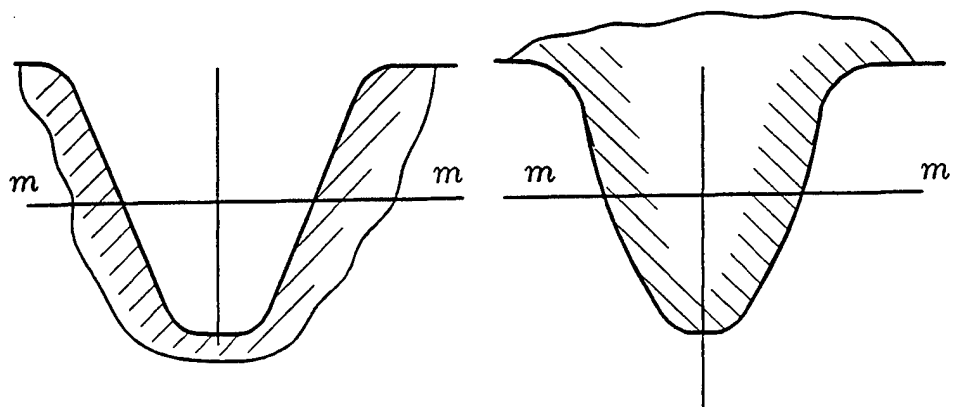


Fig. 3 Normal sections of rack-cutters

Parallel to gear axes

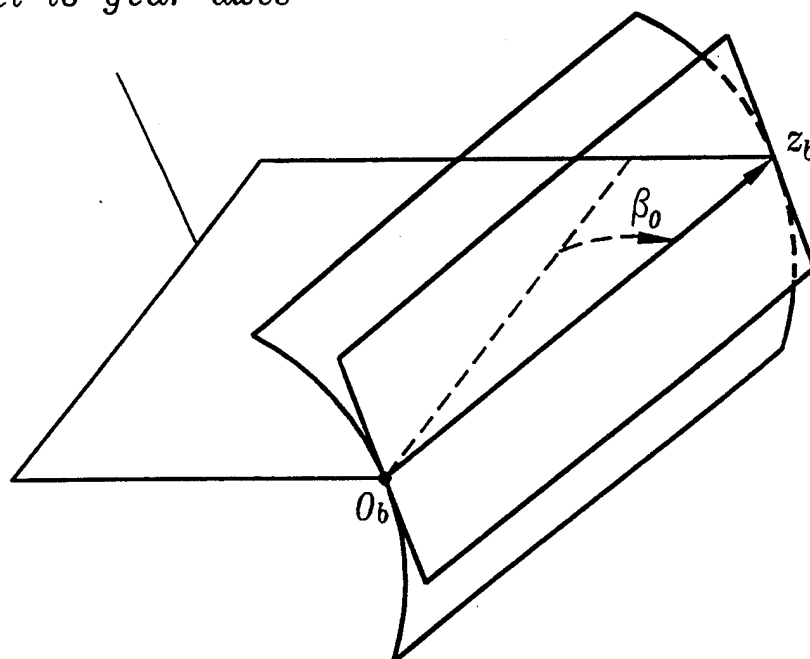


Fig. 4 Orientation of rack-cutters with respect to gear axes


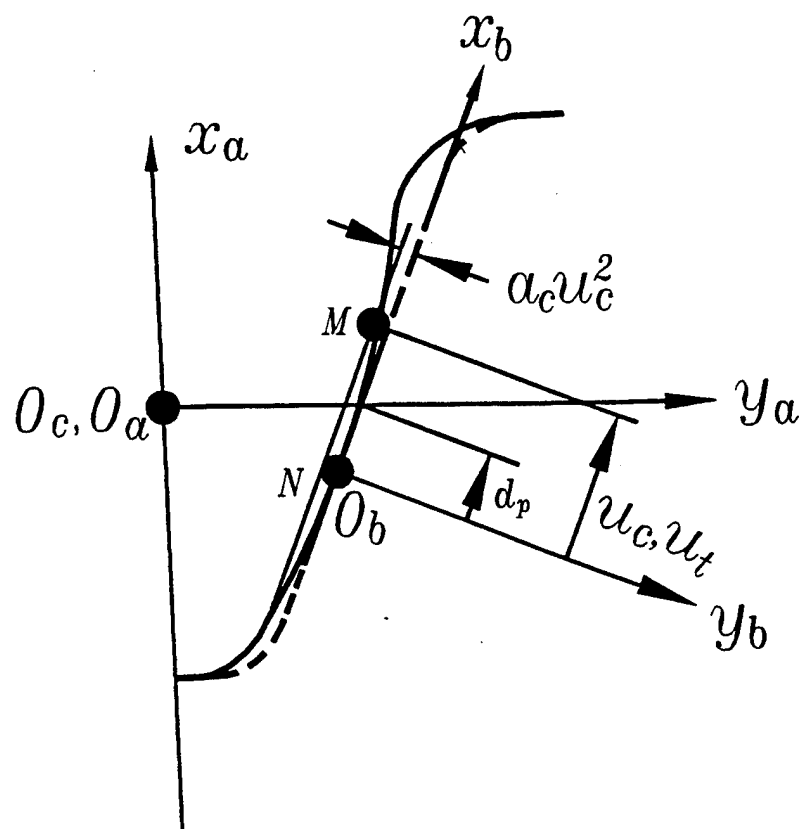


Fig. 5 Normal section of pinion rack-cutter surface

(a)

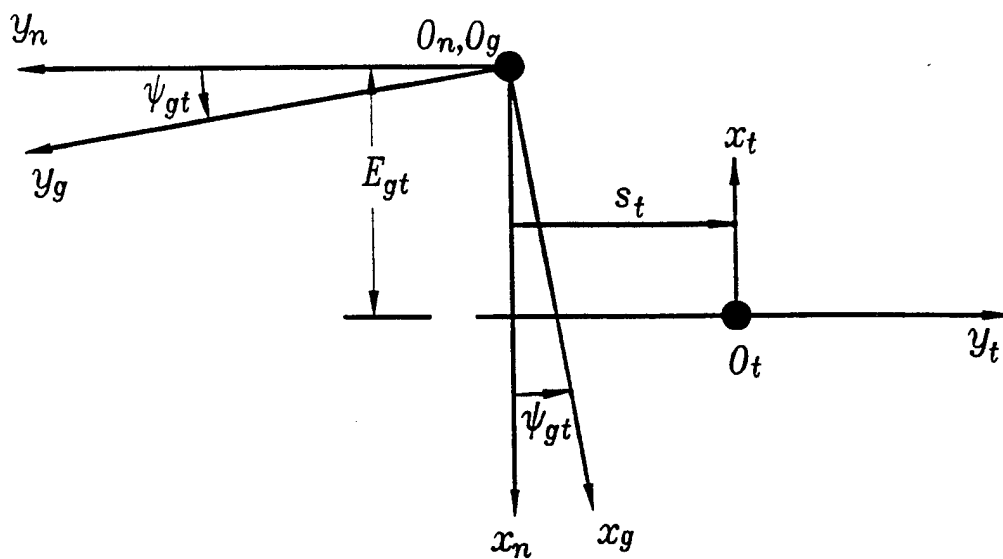

(b)

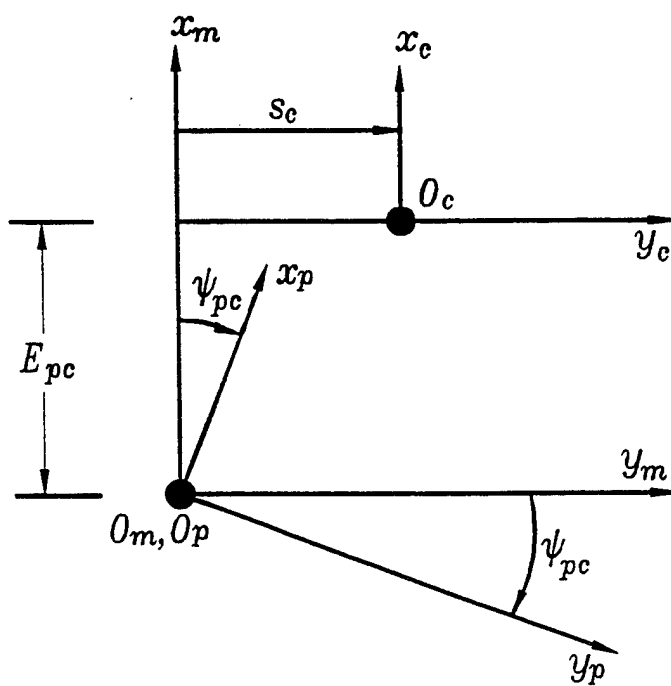


Fig. 6 Generation of pinion and gear by rack-cutters


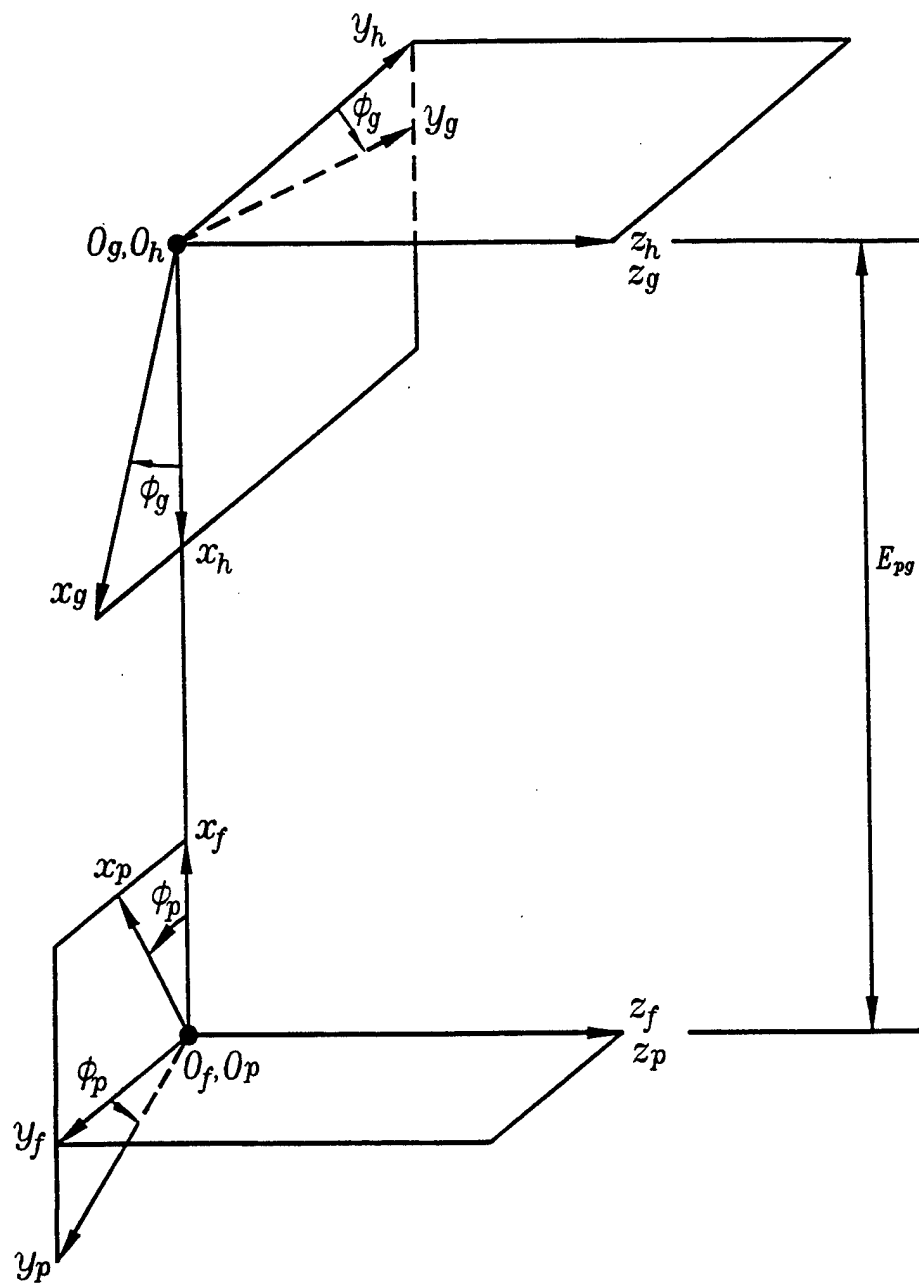


Fig. 7 Coordinate system applied for tooth contact analysis (TCA)

(a)

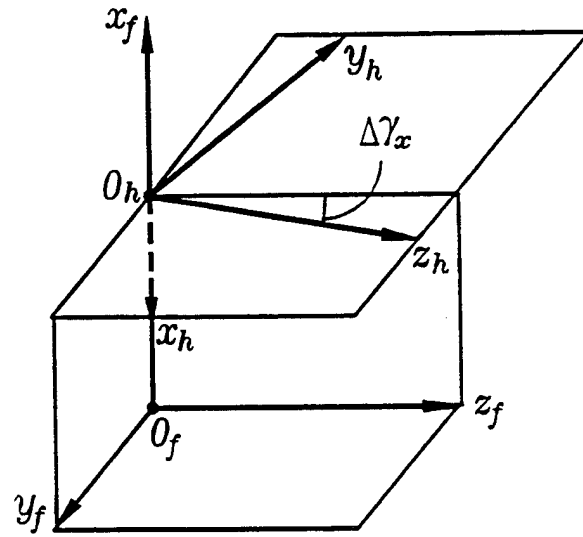

(b)

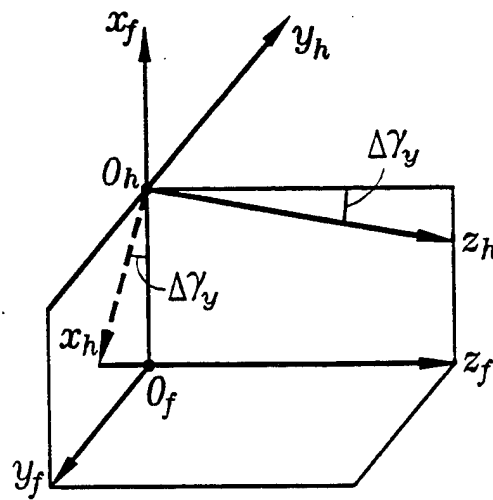


Fig. 8 Coordinate systems S_h and S_f

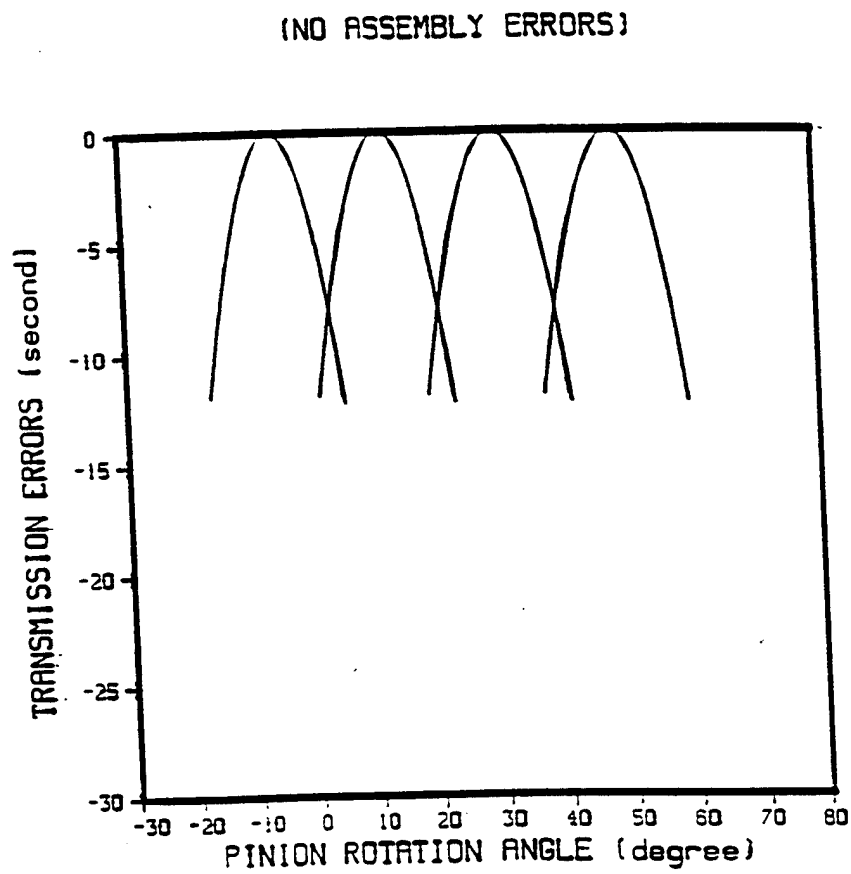


Fig. 9 Transmission errors for the aligned gear drive

NO ASSEMBLY ERRORS

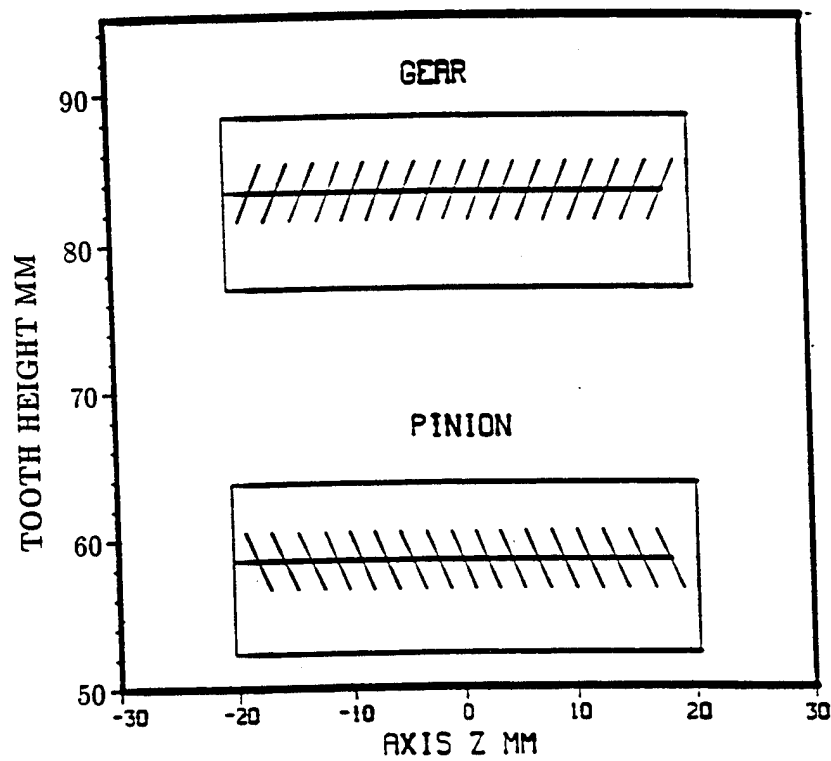


Fig. 10 Contact paths and pattern for the aligned gear drive

CROSSING ANGLE BETWEEN AXES: 4 MINUTES

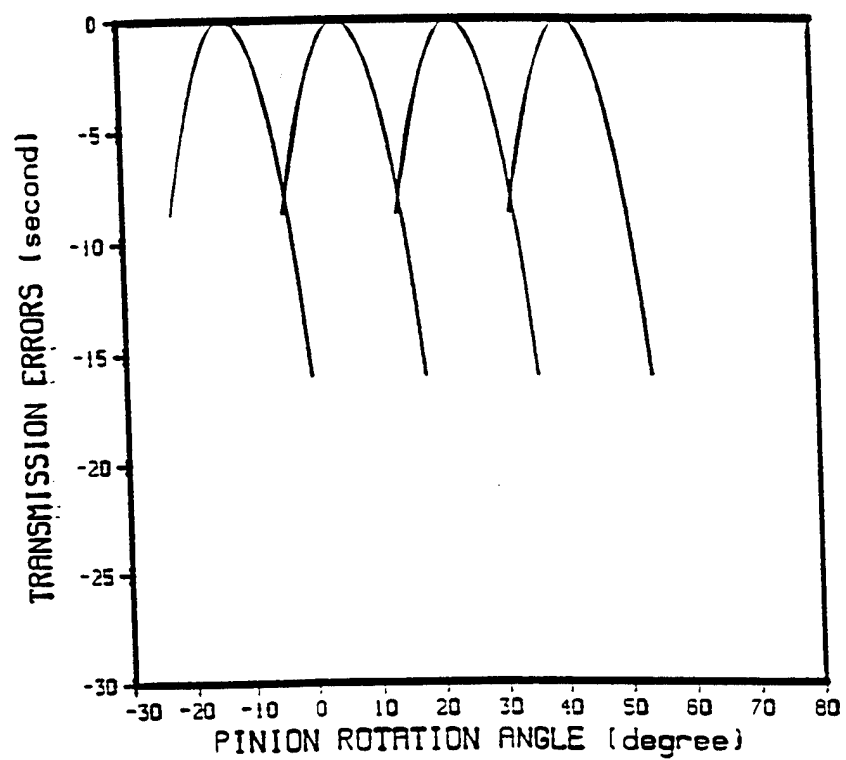


Fig. 11 Transmission errors for the alignment error
 $\Delta\gamma_{\text{cross}} = 4$ arc minutes

CROSSING ANGLE BETWEEN AXES: 4 MINUTES

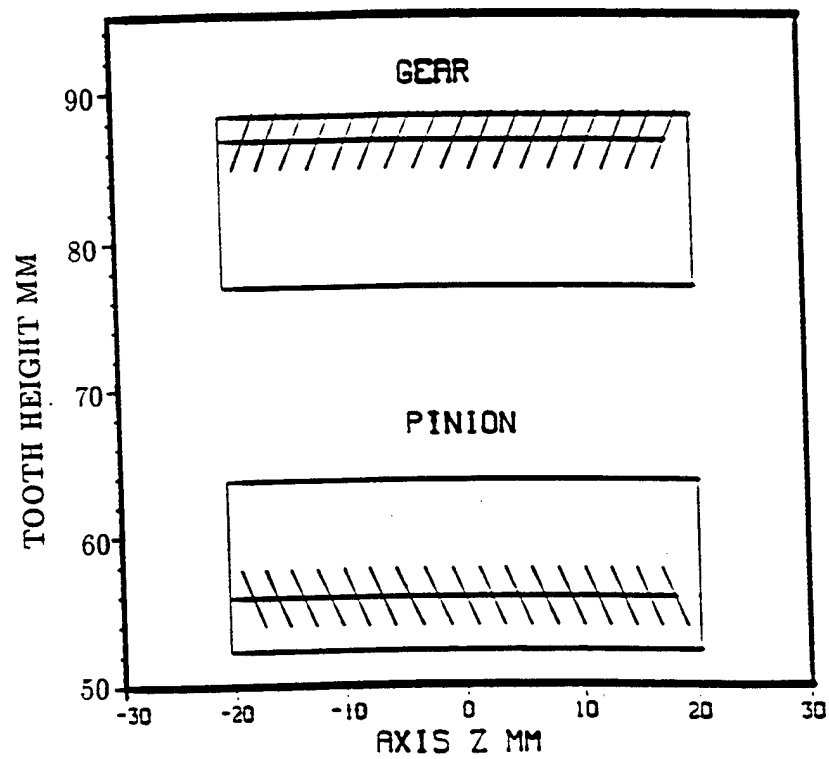


Fig. 12 Contact pattern for the alignment error

$$\Delta\gamma_{\text{cross}} = 4 \text{ arc minutes}$$

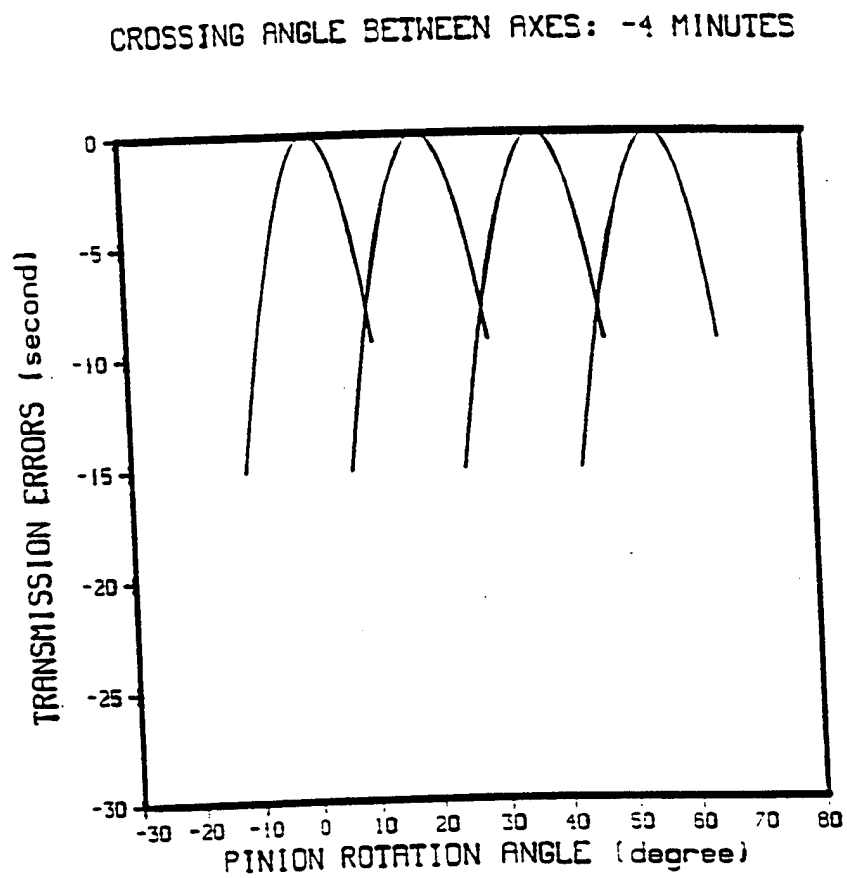


Fig. 13 Transmission errors for the alignment error

$$\Delta\gamma_{\text{cross}} = -4 \text{ arc minutes}$$

CROSSING ANGLE BETWEEN AXES: -4 MINUTES

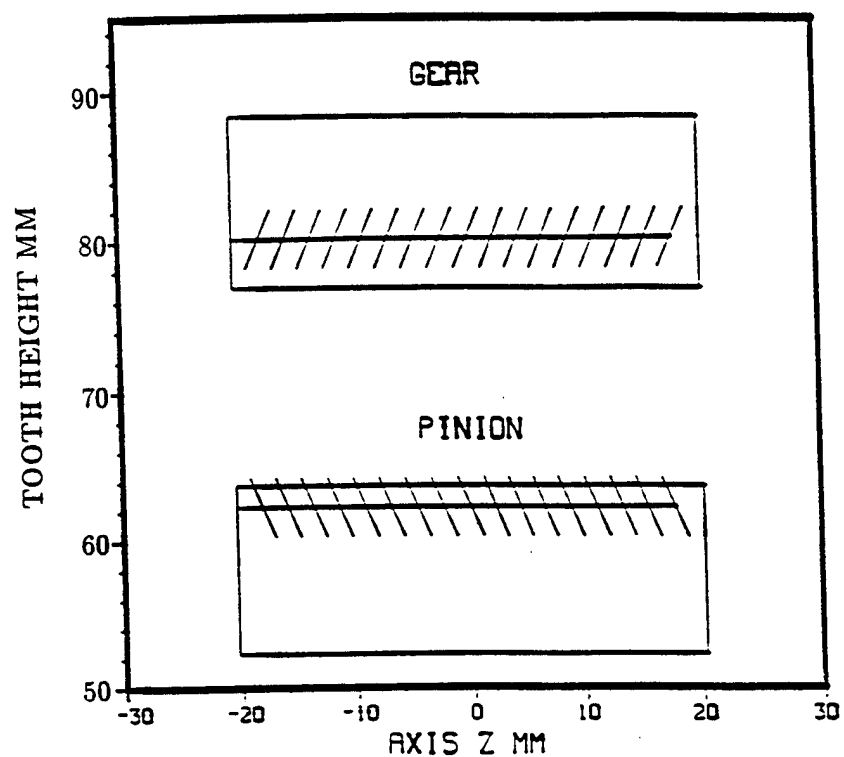


Fig. 14 Contact pattern for the alignment error

$$\Delta\gamma_{\text{cross}} = -4 \text{ arc minutes}$$

INTERSECTING ANGLE BETWEEN AXES: 4 MINUTES

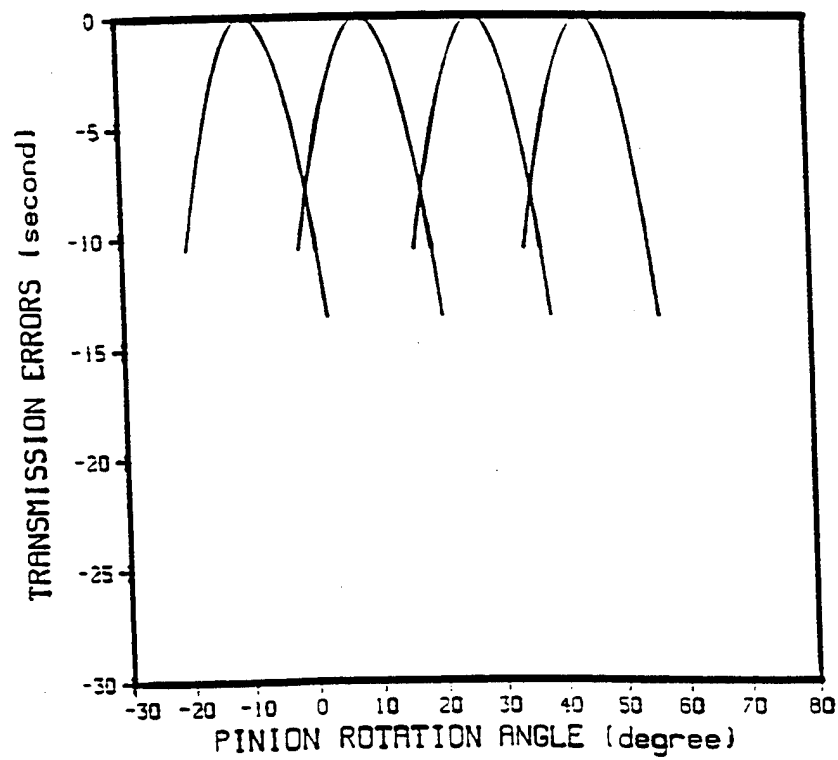


Fig. 15 Transmission errors for misaligned gear drive with
 $\Delta\gamma_{\text{intersecting}} = 4$ arc minutes

INTERSECTING ANGLE BETWEEN AXES: 4 MINUTES

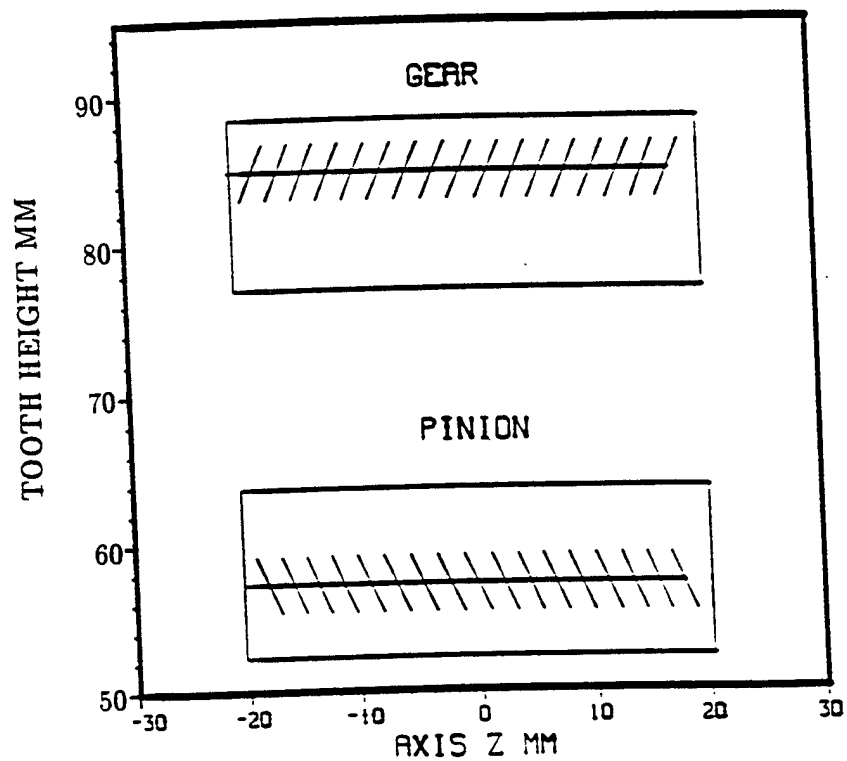


Fig. 16 Contact pattern and paths for the misaligned gear drive with $\Delta\gamma_{\text{intersecting}} = 4$ arc minutes

INTERSECTING ANGLE BETWEEN AXES: -4 MINUTES

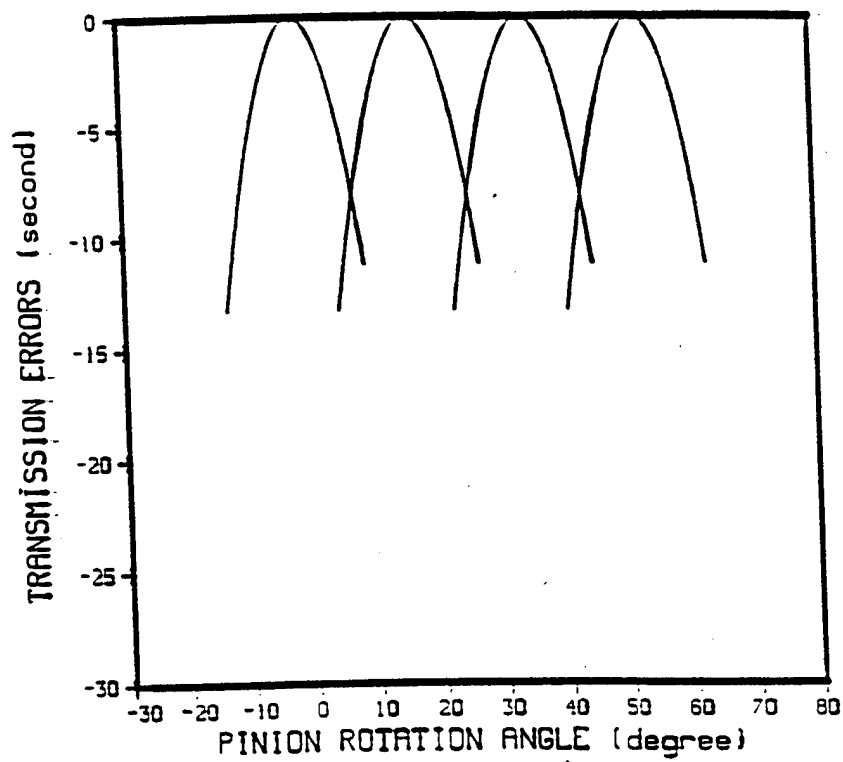


Fig. 17 Transmission errors for the misaligned gear drive with $\Delta\gamma_{\text{intersecting}} = -4$ arc minutes

INTERSECTING ANGLE BETWEEN AXES: -4 MINUTES

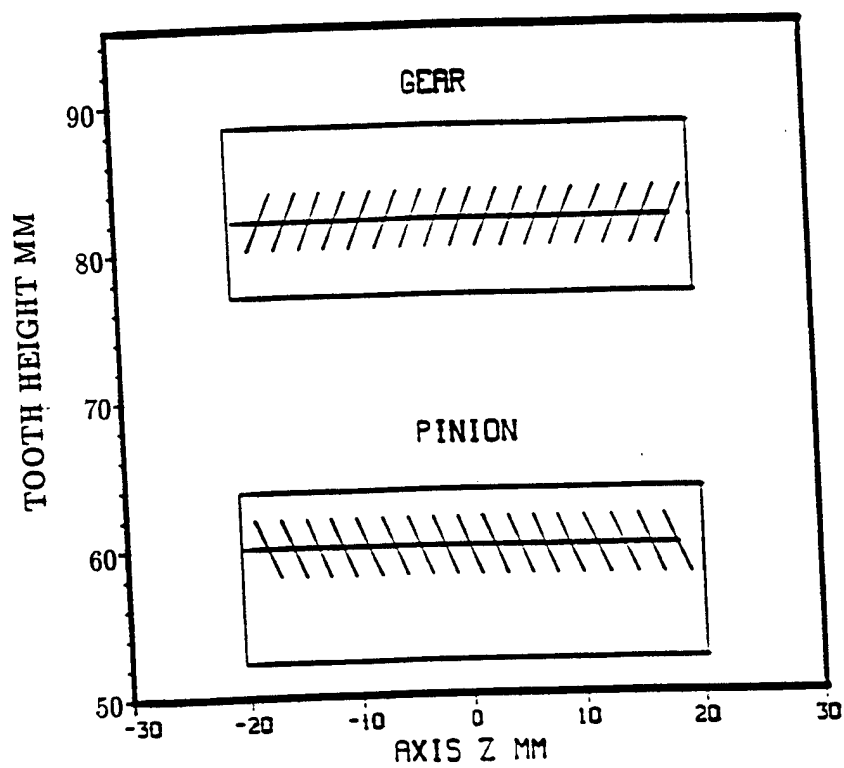


Fig. 18 Contact pattern for the misaligned gear drive with $\Delta\gamma_{\text{intersecting}} = -4$ arc minutes

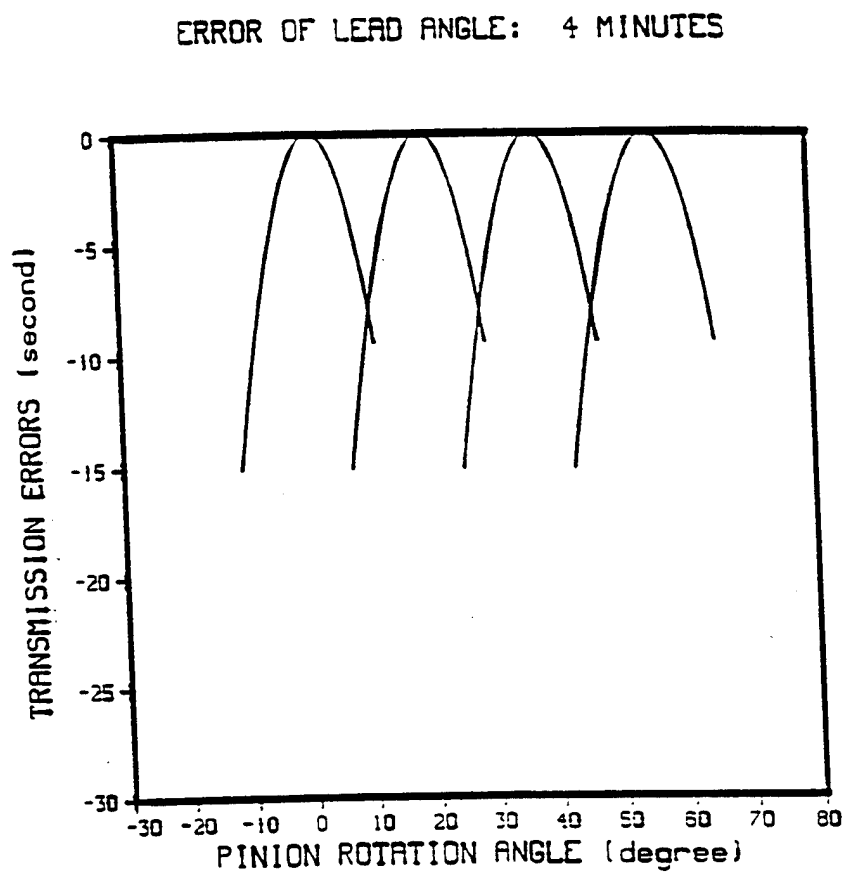


Fig. 19 Transmission errors for the misaligned gear drive with $\Delta\lambda_0 = 4$ arc minutes

ERROR OF LEAD ANGLE: 4 MINUTES

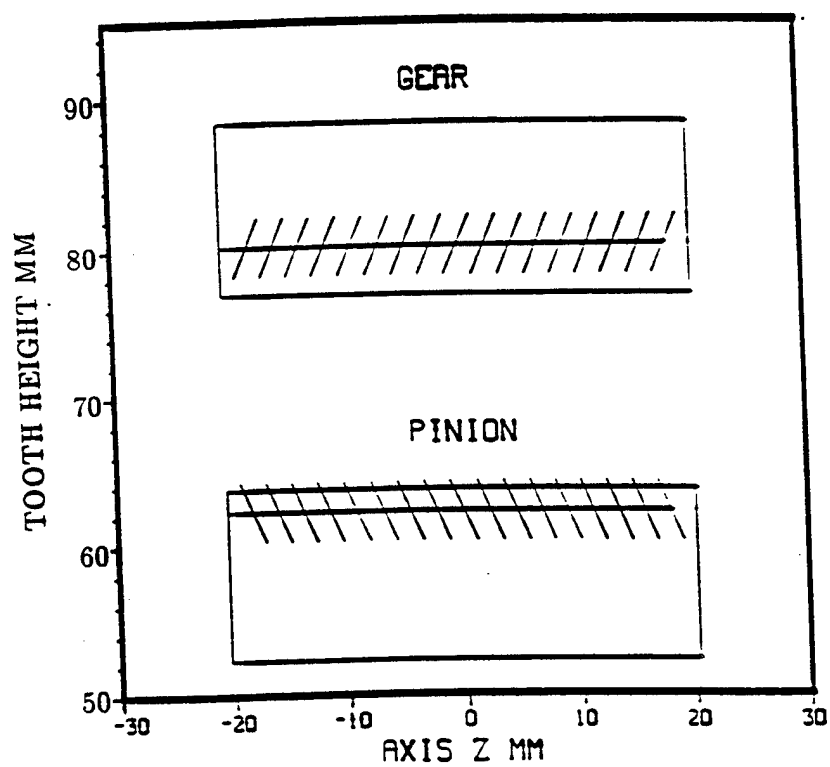


Fig. 20 Contact pattern and contact path for misaligned gear drive with $\Delta\lambda_0 = 4$ arc minutes

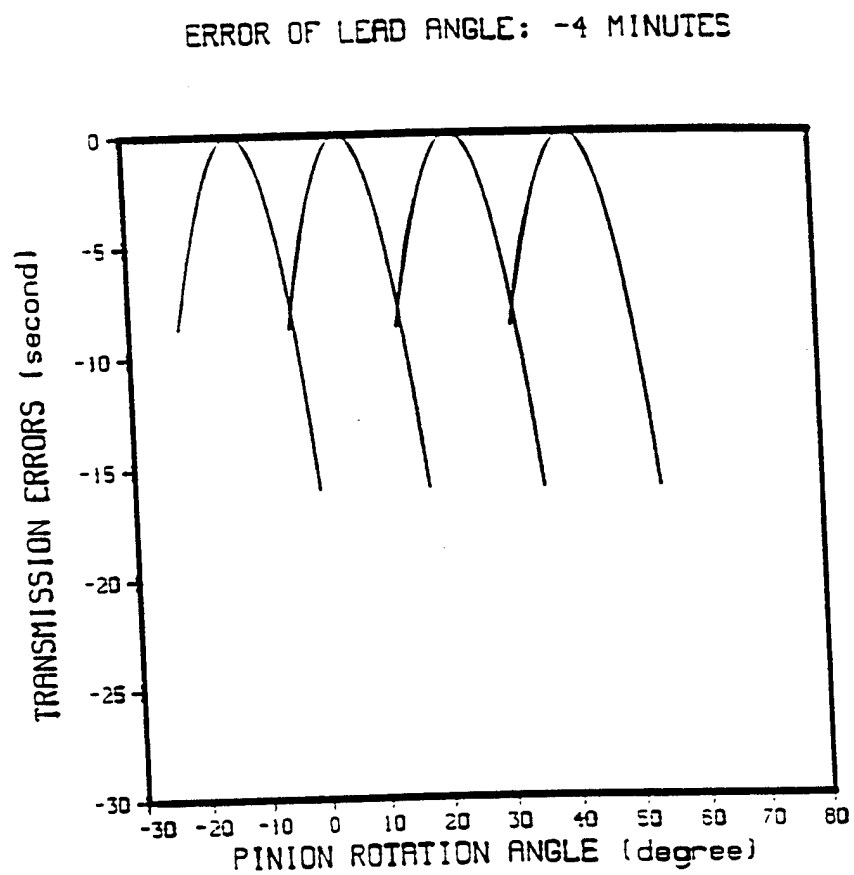


Fig. 21 Transmission errors for the misaligned gear drive with $\Delta\lambda_0 = -4$ arc minutes

ERROR OF PRESSURE ANGLE: -4 MINUTES

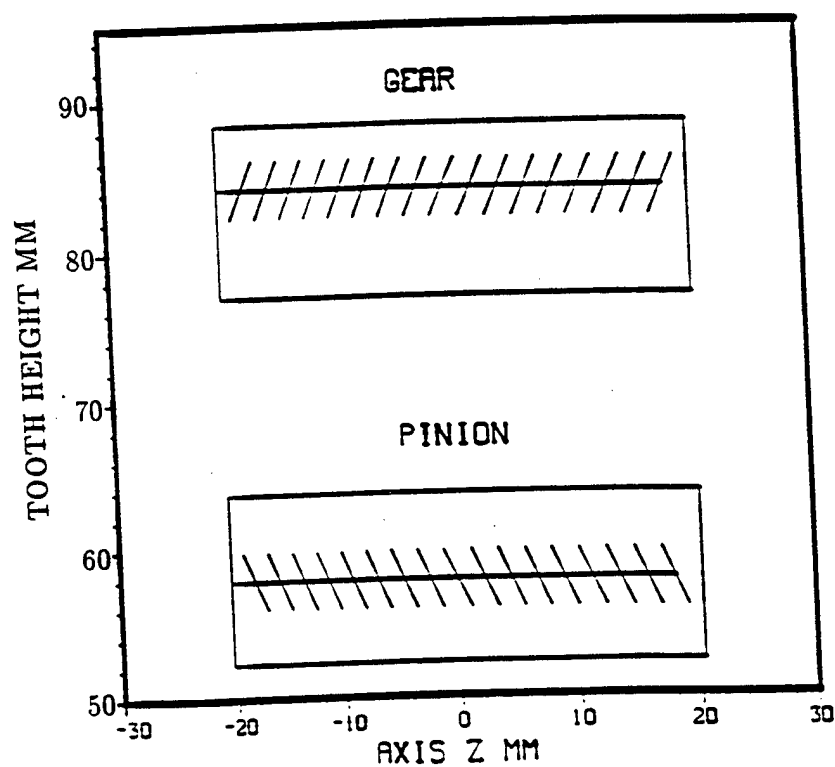


Fig. 22 Contact pattern and contact paths for the misaligned gear drive with $\Delta\lambda_0 = -4$ arc minutes

Appendix A. Relations between the Curvatures of the Generating and Generated Surfaces

Direct Relations between Principal Curvatures and Directions of Mating Surfaces

The main advantage of this approach (proposed by Litvin) is the possibility to determine the principal curvatures and directions of the generated surface in terms of principal curvatures and directions of the generating tool surface, and the parameters of motion. In this case, the tool surfaces for the generation of the gear and the pinion tooth surfaces are rack cutters. The equations developed permit a simplified computational procedure.

The system of equations that relate the principal curvatures and directions of the generating and generated surfaces is as follows. Consider that unit vectors \mathbf{e}_f and \mathbf{e}_h represent the principal directions on the tool surface Σ_1 at point P of tangency of surfaces Σ_1 and Σ_2 (fig. A1). The principal curvatures on the mating surfaces κ_f and κ_h of the tool are given; the parameters of motion (see below) are also given.

The goal is to determine angle σ that is formed by unit vectors \mathbf{e}_f and \mathbf{e}_s , and principal curvatures κ_s and κ_q . (The unit vectors \mathbf{e}_s and \mathbf{e}_q represent the principal directions on surface Σ_2). The system of equations for determination of σ , κ_s , and κ_q is as follows.

$$\tan 2\sigma = \frac{2b_{15}b_{25}}{b_{25}^2 - b_{15}^2 - (\kappa_f - \kappa_h)t_{33}} \quad (A1)$$

$$\kappa_q - \kappa_s = \frac{2b_{15}b_{25}}{t_{33} \sin 2\sigma} = \frac{b_{25}^2 - b_{15}^2 - (\kappa_f - \kappa_h)t_{33}}{t_{33} \cos 2\sigma} \quad (A2)$$

$$\kappa_q + \kappa_s = \kappa_f + \kappa_h + \frac{b_{15}^2 + b_{25}^2}{t_{33}} \quad (A3)$$

Here:

$$b_{15} = -(\omega^{(12)} \cdot \mathbf{e}_h) - \kappa_f(\mathbf{v}^{(12)} \cdot \mathbf{e}_f) \quad (A4)$$

$$b_{25} = (\omega^{(12)} \cdot \mathbf{e}_f) - \kappa_h(\mathbf{v}^{(12)} \cdot \mathbf{e}_h) \quad (A5)$$

$$t_{33} = -\mathbf{n} \cdot [(\omega^{(1)} \times \mathbf{v}_{tr}^{(2)}) - (\omega^{(2)} \times \mathbf{v}_{tr}^{(1)})] \quad (A6)$$

$$+ (\mathbf{n} \times \omega^{(12)}) \cdot \mathbf{v}^{(12)} - \kappa_f(\mathbf{v}^{(12)} \cdot \mathbf{e}_f)^2 - \kappa_h(\mathbf{v}^{(12)} \cdot \mathbf{e}_h)^2$$

The nomenclature for equations (A4) to (A6) is described as follows:

$\omega^{(1)}$ angular velocity of the generating tool

$\omega^{(2)}$ angular velocity of the generated gear

$\omega^{(12)}$ defined as $\omega^{(1)} - \omega^{(2)}$

$\mathbf{v}_{tr}^{(1)}$ transfer motion velocity of the generating tool

$\mathbf{v}_{tr}^{(2)}$ transfer motion velocity of the generated gear

$\mathbf{v}^{(12)}$ defined as $\mathbf{v}_{tr}^{(1)} - \mathbf{v}_{tr}^{(2)}$

\mathbf{n} surface unit normal vector

The equations discussed above are used in the TCA program for determination of the contact ellipse at the points of contact path of the modified helical gear drive.

Numerical Example

The input and output for the determination of the principal curvatures of the pinion tooth surface are shown in Tables A1 and A2. The input and output for the determination of the principal curvatures of the gear tooth surface are shown in Tables A3 and A4.

Table A1 Input Data

Description	Symbol	Values
first principal curvature of tool	κ_f	-0.0016 (1/mm)
second principal curvature of tool	κ_h	0.0 (1/mm)
first principal direction of tool	e_f	$[0.0016 \ -0.4999 \ 0.8660]^T$
second principal direction of tool	e_h	$[0.9387 \ 0.2992 \ 0.1710]^T$
angular velocity of tool (1/sec)	$\omega^{(1)}$	$[0.0 \ 0.0 \ 0.0]^T$
angular velocity of pinion (1/sec)	$\omega^{(2)}$	$[0.0 \ 0.0 \ 1.0]^T$
transfer velocity of tool (mm/sec)	$v_{tr}^{(1)}$	$[0.0 \ 58.6588 \ 0.0]^T$
transfer velocity of pinion (mm/sec)	$v_{tr}^{(2)}$	$[-0.1514 \ 58.5951 \ 0.0]^T$
surface normal of tangent point	n	$[-0.3420 \ 0.8138 \ 0.4698]^T$

Table A2 Output Data

Description (for pinion)	Symbol	Values
first principal curvature	κ_s	-0.001543 (1/mm)
second principal curvature	κ_q	0.03907 (1/mm)
first principal direction	e_s	$[0.1751 \ -0.4361 \ 0.8827]^T$
second principal direction	e_q	$[0.9222 \ 0.3865 \ 0.0080]^T$

Table A3 Input Data

Description	Symbol	Values
first principal curvature of tool	κ_f	0.0 (1/mm)
second principal curvature of tool	κ_h	0.0 (1/mm)
first principal direction of tool	\mathbf{e}_f	$[0.9397 \ 0.2962 \ 0.1710]^T$
second principal direction of tool	\mathbf{e}_h	$[0.0 \ -0.5 \ 0.8660]^T$
angular velocity of tool (1/sec)	$\omega^{(1)}$	$[0.0 \ 0.0 \ 0.0]^T$
angular velocity of gear (1/sec)	$\omega^{(2)}$	$[0.0 \ 0.0 \ -0.2003]^T$
transfer velocity of tool (mm/sec)	$\mathbf{v}_{tr}^{(1)}$	$[0.0 \ 58.6588 \ 0.0]^T$
transfer velocity of gear (mm/sec)	$\mathbf{v}_{tr}^{(2)}$	$[-0.2096 \ 58.7218 \ 0.0]^T$
surface normal of tangent point	\mathbf{n}	$[-0.3420 \ 0.8138 \ 0.4698]^T$

Table A4 Output Data

Description (for gear)	Symbol	Values
first principal curvature	κ_s	-0.007836 (1/mm)
second principal curvature	κ_q	0.0 (1/mm)
first principal direction	\mathbf{e}_s	$[0.9219 \ 0.3874 \ 0.0]^T$
second principal direction	\mathbf{e}_q	$[0.1820 \ -0.4331 \ 0.8827]^T$

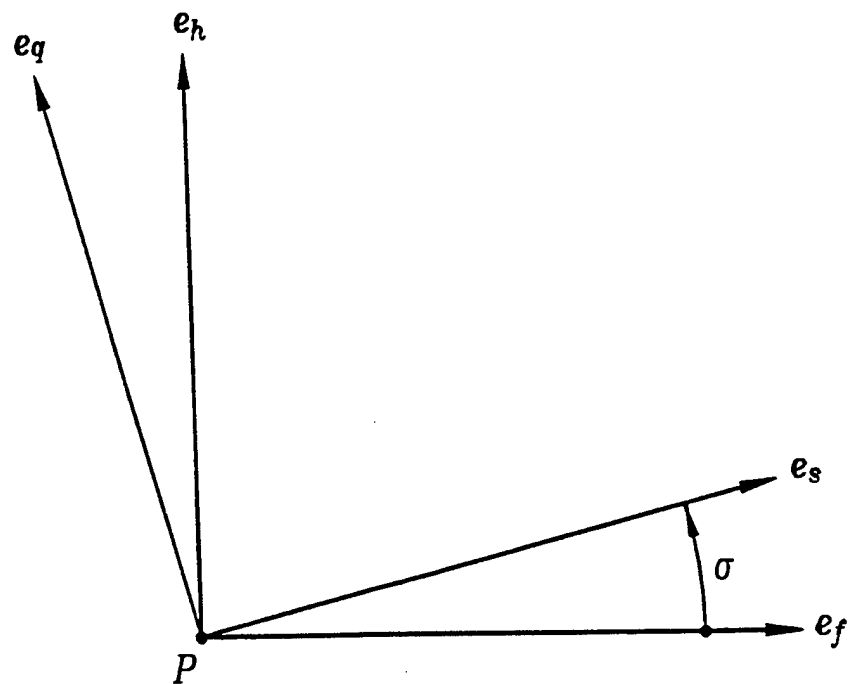


Fig. A1 Principal Directions

Appendix B. Contact Ellipse

Determination of Dimensions and Orientation of Instantaneous Contact Ellipse

The gear tooth surfaces are in point contact at every instant. Due to elastic deformation of gear tooth surfaces the contact is spread over an elliptical area and the center of the ellipse coincides with the instantaneous contact point. The bearing contact is formed as the set of instantaneous contact ellipses.

The dimensions and orientation of the instantaneous contact ellipse can be determined using the data about the principal curvatures and directions of the contacting surfaces, and the elastic approach of the surfaces. The elastic approach depends on the applied load but we will consider it as a given value that is known from experimental data.

The determination of the instantaneous contact ellipse is based on the following equations (proposed by Litvin):

$$\cos 2\alpha^{(1)} = \frac{g_1 - g_2 \cos 2\sigma}{(g_1^2 - 2g_1g_2 \cos 2\sigma + g_2^2)^{1/2}} \quad (B1)$$

$$\sin 2\alpha^{(1)} = \frac{g_2 \sin 2\sigma}{(g_1^2 - 2g_1g_2 \cos 2\sigma + g_2^2)^{1/2}} \quad (B2)$$

$$2a = 2 \left| \frac{\delta}{A} \right|^{1/2}, \quad 2b = 2 \left| \frac{\delta}{B} \right|^{1/2} \quad (B3)$$

where

$$A = \frac{1}{4}[\kappa_{\Sigma}^{(1)} - \kappa_{\Sigma}^{(2)} - (g_1^2 - 2g_1g_2 \cos 2\sigma + g_2^2)^{1/2}] \quad (B4)$$

$$B = \frac{1}{4}[\kappa_{\Sigma}^{(1)} - \kappa_{\Sigma}^{(2)} + (g_1^2 - 2g_1g_2 \cos 2\sigma + g_2^2)^{1/2}] \quad (B5)$$

$$\kappa_{\Sigma}^{(i)} = \kappa_I^{(i)} + \kappa_{II}^{(i)}, \quad g_i = \kappa_I^{(i)} - \kappa_{II}^{(i)} \quad (B6)$$

Here (fig. B1) $\alpha^{(1)}$ is the angle that is formed by axis η of the contact ellipse with the unit vector $\mathbf{e}_f^{(1)}$ of the principal direction on surface Σ_1 ; σ is the angle formed by unit vectors $\mathbf{e}_f^{(1)}$ and $\mathbf{e}_f^{(2)}$ of the principal directions of the contacting surfaces; $2a$ and $2b$ are the axes of the contact ellipse; δ is the elastic approach; and $\kappa_f^{(i)}$ and $\kappa_h^{(i)}$ are two principal directions of tooth surface i .

Numerical Example

The input and output for the determination of the contact ellipse are shown in Tables B1 and B2.

Table B1 Input Data

Description	Symbol	Values
pinion first principal curvature	κ_s	-0.001543 (1/mm)
pinion second principal curvature	κ_q	0.03907 (1/mm)
pinion first principal direction	\mathbf{e}_s	$[0.1751 \ -0.4361 \ 0.8827]^T$
pinion second principal direction	\mathbf{e}_q	$[0.9222 \ 0.3865 \ 0.0080]^T$
gear first principal curvature	κ_f	-0.007836 (1/mm)
gear second principal curvature	κ_h	0.0 (1/mm)
gear first principal direction	\mathbf{e}_f	$[-0.9219 \ -0.3874 \ 0.0]^T$
gear second principal direction	\mathbf{e}_h	$[-0.1820 \ 0.4331 \ 0.8827]^T$
elastic approach	δ	0.007 (mm)

Table B2 Output Data

Description	Symbol	Values
long axis of contact ellipse	$2a$	6.026 (mm)
short axis of contact ellipse	$2b$	1.092 (mm)
angle between long axis and the first principal direction of pinion	$\alpha^{(1)}$	89.87 (deg)

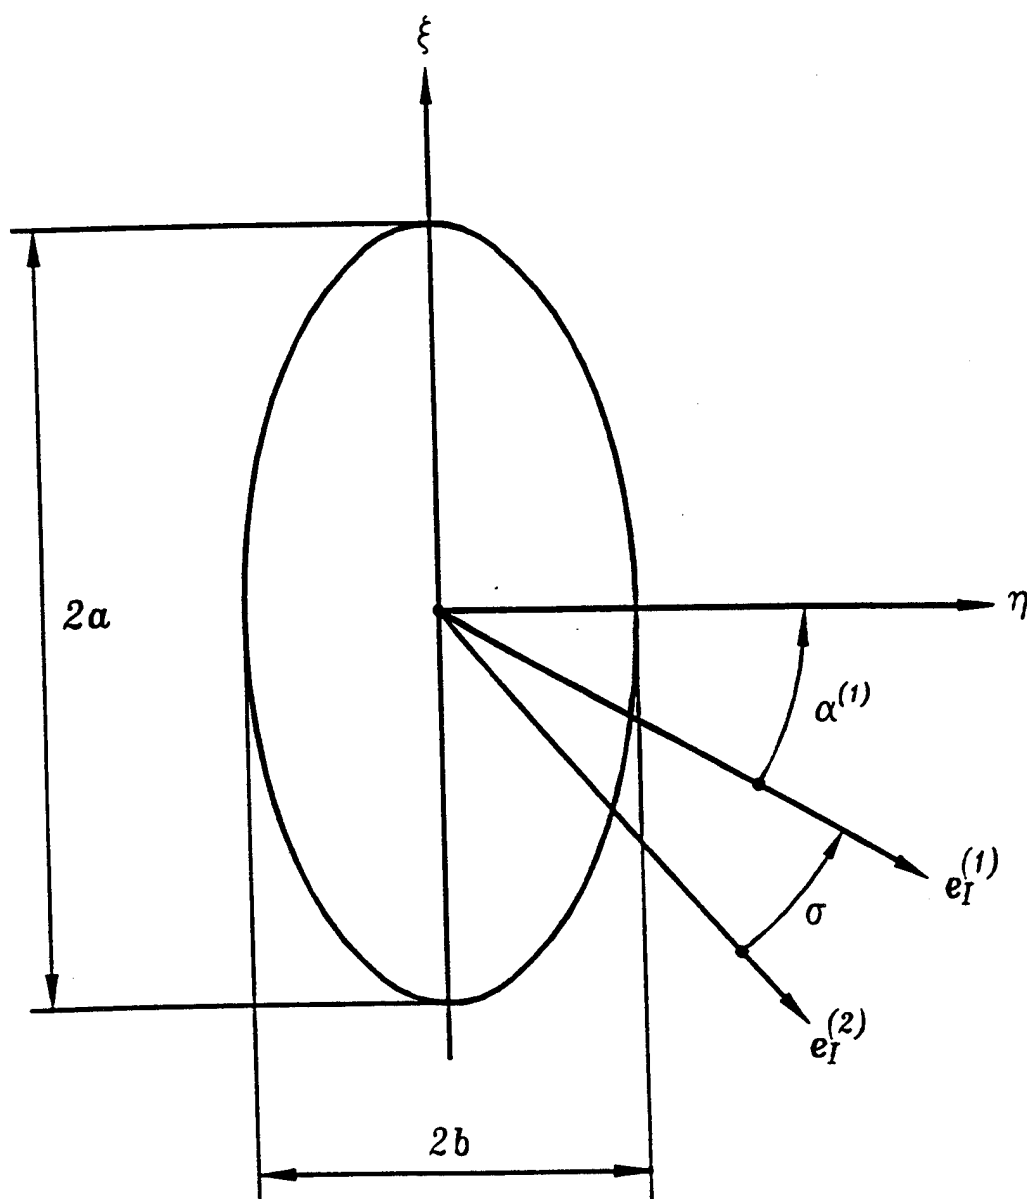


Fig. B1 Orientation and dimensions of contact ellipse

Appendix C. Directions for Users of Application of Computer Program

C.1 Introduction

The name of the computer program is HELTCA.FOR. It is written in FORTRAN77 language. The operating system is CMS-9.0. A subroutine DNEQNF to solve a system of nonlinear equations should be available in the Math-Library or working environment. The subroutine is not included in the program. The program will call the subroutine DNEQNF several times.

C.2 Input Block

The input block consists of three parts: (1) design parameters of pinion and gear; (2) the controlled modification parameters; and (3) parameters for TCA.

Part 1. Design parameters of pinion and gear

In the beginning of the computer program, you can read the following lines:

```
C... A11.....COEFFICIENT FOR TRANSFORMATION OF DEGREE TO RADIAN  
A11=DACOS(-1.D0)/180.D0
```

```
C
```

```
C... KHD=1 FOR RIGHT-HAND PINION AND LEFT-HAND GEAR  
C... KHD=2 FOR LEFT-HAND PINION AND RIGHT-HAND GEAR
```

```
KHD=2
```

If you write "KHD=1", the computer will use the necessary equations for the case of right-hand pinion and left-hand gear. The computations will be accomplished for a left-hand pinion and right-hand gear if you use "KHD=2".

Then, the variable definition for the pinion follows:

```
C
```

```
C... INPUT THE DESIGN PARAMETERS OF PINION
```

```
C...
```

```
C... TN1.....GEAR NUMBER OF TEETH
```

```
C... PN1.....NORMAL DIAMETRAL PITCH (1/MM)
```

```
C... PSIN1.....NORMAL PRESSURE ANGLE (RAD.)
```

```
C... BETAP1.....HELICAL ANGLE ON PITCH CYLINDER (RAD.)
```

```
C... ADG1.....ADDENDUM (MM)
```

```

C... DEG1.....DEDENDUM (MM)
C... LAMDP1.....LEAD ANGLE ON PITCH CYLINDER (RAD.)
C... FW1.....FACE WIDTH (MM)
C... RPT1.....RADIUS OF PITCH CYLINDER (MM)
C... RBT1.....RADIUS OF BASE CYLINDER (MM)
C... RAT1.....RADIUS OF ADDENDUM CYLINDER (MM)
C... RDT1.....RADIUS OF DEDENDUM CYLINDER (MM)
C... PSIT1.....TRANSVERSE PRESSURE ANGLE (RAD.)
C... LAMDB1.....LEAD ANGLE ON BASE CYLINDER (RAD.)
C

```

In accordance with our numerical example (see Table 1), the following data would be used:

```

TN1=20.D0
PN1=5.D0/25.4D0
PSIN1=A11*20.D0
LAMDP1=A11*60.D0
BETAP1=A11*30.D0
FW1=25.4D0*1.6D0
ADG1=1.D0/PN1
DEG1=1.25D0/PN1

```

The following variables are used for the gear:

```

C
C... INPUT THE DESIGN PARAMETERS OF GEAR
C
C... TN2.....GEAR NUMBER OF TEETH
C... PN2.....NORMAL DIAMETRAL PITCH (1/MM)
C... PSIN2.....NORMAL PRESSURE ANGLE (RAD.)
C... BETAP2.....HELICAL ANGLE ON PITCH CYLINDER (RAD.)
C... ADG2.....ADDENDUM (MM)
C... DEG2.....DEDENDUM (MM)
C... LAMDP2.....LEAD ANGLE ON PITCH CYLINDER (RAD.)
C... FW2.....FACE WIDTH (MM)
C... RPT2.....RADIUS OF PITCH CYLINDER (MM)
C... RBT2.....RADIUS OF BASE CYLINDER (MM)
C... RAT2.....RADIUS OF ADDENDUM CYLINDER (MM)
C... RDT2.....RADIUS OF DEDENDUM CYLINDER (MM)
C... PSIT2.....TRANSVERSE PRESSURE ANGLE (RAD.)
C... LAMDB2.....LEAD ANGLE ON BASE CYLINDER (RAD.)
C

```

From the design parameters listed in Table 1, we have


```

TN2=100.D0
PN2=5.D0/25.4D0
A11=DACOS(-1.D0)/180.D0
PSIN2=A11*20.D0
LAMDP2=A11*60.D0
BETAP2=A11*30.D0
FW2=25.4D0*1.6D0
ADG2=1.D0/PN2
DEG2=1.25D0/PN2

```

If KHD=2, the computer program will change the values of some design parameters as follows

```

C
      IF(KHD.EQ.2) THEN
        LAMDP1=-LAMDP1
        BETAP1=-BETAP1
        LAMDP2=-LAMDP2
        BETAP2=-BETAP2
      ENDIF

```

The computer program call the following subroutines "DATAT1" and "DATAT2" to calculate other tooth element proportions and output the whole data in file 55 (see below).

```

      CALL DATAT1
      CALL DATAT2

```

Part 2. Control of modification parameter for application in the TCA program

At this stage we can read

```

C
C..... THE FOLLOWING DATA IS FOR THE TO-BE CONTROLLED MODIFICATION
PARAMETERS
C
C... AA... MODIFICATION PARAMETER OF GEAR
C... AP... MODIFICATION PARAMETER OF PINION RACK-CUTTER
C... DP... TANGENT POINT N OF PROFILES OF PINION & GEAR RACK-CUTTERS
C... THET2P..INITIAL ANGLE FOR MODIFICATION OF GEAR (RAD.)

```

You must input the four parameters for modification of pinion and gear surfaces, for example:

```

AA=-0.0014D0
THET2P=-0.08D0
AP=-0.0008
DP=-DSIN(PSIN1)*DCOS(-1.D0)*RPT1/TN1/8.D0

```

The above four controlling parameters should be tried several times in order to obtain better contact pattern and transmission errors optimal for a given design.

Part 3. Parameters for TCA

In this part, the alignment errors expected should be input:

```
C
C  PARAMETERS FOR TCA
C
C.. KM .. SWITCH 1 FOR CROSSING ANGLE  $\Delta\gamma_x$  & 2 FOR INTERSECTION
ANGLE  $\Delta\gamma_y$ 
C.. DGAM..ANGLE OF MISALIGNMENT(CROSSING OR INTERSECTION) (ARC
MINUTE)
C.. DEE... CHANGE OF CENTER DISTANCE (MM)
C
```

If a crossing angle of misalignment is considered, should input "KM=1". Input "KM=2" if an intersection angle of misalignment is considered. For an aligned gear drive, input "DGAM=0.0". For instance, if $\Delta\gamma_x = 4'$, $\Delta E = 0$, input the following lines:

```
C      KM=1
      KM=2
      DGAM=4.0*A11/60.D0
      DEE=0.000D0
```

Then you will read the following sentence:

```
C
C.... THE INPUT BLOCK IS READY
```

Usually, you cannot make changes anything after this step.

C.3 Output Block

After the input block is filled out, you can read the following explanation for the output files:

```
C
C... OUTPUT DATA FILES ARE THE FOLLOWINGS
C
C... FILE 55... TOOTH PROPORTIONS OF PINION AND GEAR
C... FILE 85... CONTACT PATH ON PINION SURFACE (2D)
C... FILE 86... CONTACT PATH ON GEAR SURFACE (2D)
C... FILE 87... LENGTH AND DIRECTIONS OF CONTACT ELLIPSE ON PINION
AND GEAR SURFACES (2D)
```

C... FILE 90... TRANSMISSION ERRORS

C

C.....

C

1) File 55

In File 55 the information about the pinion and gear are listed.

2) Files 85 and 86

There are two coordinates in File 85 for each contact point of the pinion: Radial $(x_p^2 + y_p^2)^{0.5}$ and axial z_p . There are two coordinates in File 86 for each contact point of the gear: Radial $(x_g^2 + y_g^2)^{0.5}$ and axial z_g .

3) File 87

There are 5 values in File 87 for each pair of contact points of the pinion and gear. The first one is the value of the major semi-axis of the contact ellipse. The second and third values are the cosine directions of the major axis of the contact ellipse on the pinion tooth surface. The last two values are the cosine direction of the major axis of the contact ellipse on the gear tooth surface.

C.4 Computer Program

C..... TCA FOR MODIFIED HELICAL GEARS.....

```

PROGRAM HELTCA
IMPLICIT REAL*8(A-H,O-Z)
REAL*8 XI(9),X(9),F(9)
REAL*8 LF1(3,3),LH2(3,3),L1F(3,3),L2H(3,3)
REAL*8 R1F(3),R2F(3),N1F(3),N2F(3)
REAL*8 DPHI(2,180),DDPHI(2,180,4)
REAL*8 ELAL(180),EL1(2,180),EL2(2,180)
REAL*8 LFH(3,3),LHF(3,3)
REAL*8 V1(3),V2(3),V3(3),V4(3),V5(3)
REAL*8 RG2(3),NG2(3)
REAL*8 RG1(3),NG1(3)
REAL*8 UI(3),UJ(3),UK(3)
REAL*8 LAMDP2,LAMDB2
REAL*8 LAMDP1,LAMDB1
REAL*8 UT2,KT21,KT22
REAL*8 AVC1(3),VTR1(3),AVC2(3),VTR2(3)
REAL*8 KSIG1,KSIG2,KFF,KHH
REAL*8 EFN(3),EHN(3),W1VT2(3),WV12(3),W2VT1(3),KF,KH,KS,KQ
REAL*8 KM2,KT2
REAL*8 KFP,KHP,KFG,KHG
COMMON /A300/ ES(3),EQ(3)
COMMON /A310/ KFF,KHH
COMMON /A340/ EFF(3),EHH(3)
COMMON /A360/ A,B,SI(3),FI(3)
COMMON /A200/ W1(3),W2(3),W12(3),VT1(3),VT2(3),V12(3)
COMMON /A210/ EX(3),EF(3),EH(3)
COMMON /A212/ EF2(3),EH2(3),KF2,KH2
COMMON /A220/ KF,KH
COMMON /A230/ ET(3),EM(3)
COMMON /A380/ KS,KQ
COMMON /A400/ VT11(3),VT12(3),VT21(3),VT22(3)
COMMON /A401/ KHP,KFP,KHG,KFG
EXTERNAL FCNG,FCNC,FCNT
COMMON /AXIS/ UI,UJ,UK
COMMON /NET/ RR,DD
COMMON /DD/ DF,KPRI
COMMON /DATT2/ TN2,PN2,PSIN2,BETAP2,ADG2,DEG2,LAMDP2,
& UP2,FW2,RPT2,RBT2,RAT2,RDT2,PSIT2,LAMDB2
COMMON /DATT/ TN1,PN1,PSIN1,BETAP1,ADG1,DEG1,LAMDP1,
& FW1,RPT1,RBT1,RAT1,RDT1,PSIT1,LAMDB1
COMMON /B2/ XNP1,YNP1,ZNP1,XNP2,YNP2,ZNP2
COMMON /B4/ X1,Y1,Z1,XN1,YN1,ZN1
COMMON /B5/ X2,Y2,Z2,XN2,YN2,ZN2
COMMON /B6/ THET2P,DGPHI2
COMMON /W1/ ETAW1,UPP1,SPP1,ETAW2,UPP2,SPP2
COMMON /SG1/ RG1,NG1,AP,DP
COMMON /SG2/ RG2,NG2,AA
COMMON /ATT/ PHI1,PHI2,R1F,R2F,N1F,N2F,LFH,CC,DGAM,DPHI2
COMMON /MVT/ LF1,LH2
COMMON /AST/ ICONT
COMMON /ATS/ DPHI1

```

C... A11.....COEFFICIENT FOR TRANSFORMATION OF DEGREE TO RADIAN
A11=DACOS(-1.D0)/180.D0

C... KHD=1 FOR RIGHT-HAND PINION AND LEFT-HAND GEAR

C... KHD=2 FOR LEFT-HAND PINION AND RIGHT-HAND GEAR

KHD=2

C... INPUT THE DESIGN PARAMETERS OF PINION

C... TN1.....GEAR NUMBER OF TEETH

C... PN1.....NORMAL DIAMETRAL PITCH (MM)

```

C... PSIN1.....NORMAL PRESSURE ANGLE (RAD.)
C... BETAP1.....LEADING ANGLE OF THE HELIX ON PITCH CYLINDER (RAD.)
C... ADG1..... ADDENDUM (MM)
C... DEG1..... DEDENDUM (MM)
C... LAMDP1.....HELIX ANGLE ON PITCH CYLINDER (RAD.)
C... FW1.....FACE WIDTH (MM)
C... RPT1.....RADIUS OF PITCH CYLINDER (MM)
C... RBT1.....RADIUS OF BASE CYLINDER (MM)
C... RAT1.....RADIUS OF ADDENDUM CYLINDER (MM)
C... RDT1.....RADIUS OF DEDENDUM CYLINDER (MM)
C... PSIT1.....TRANSVERSE PRESSURE ANGLE (RAD.)
C... LAMDB1.....HELIX ANGLE ON BASE CYLINDER (RAD.)
    TN1=20.D0
    PN1=5.D0/25.4D0
    PSIN1=A11*20.D0
    LAMDP1=A11*60.D0
    BETAP1=A11*30.D0
    FW1=25.4D0*1.6D0
    ADG1=1.D0/PN1
    DEG1=1.25D0/PN1
C... INPUT THE DESIGN PARAMETERS OF GEAR
C... TN2.....GEAR NUMBER OF TEETH
C... PN2.....NORMAL DIAMETRAL PITCH (1/MM)
C... PSIN2.....NORMAL PRESSURE ANGLE (RAD.)
C... BETAP2.....LEADING ANGLE OF THE HELIX ON PITCH CYLINDER (RAD.)
C... ADG2..... ADDENDUM (MM)
C... DEG2..... DEDENDUM (MM)
C... LAMDP2.....HELIX ANGLE ON PITCH CYLINDER (RAD.)
C... FW2.....FACE WIDTH (MM)
C... RPT2.....RADIUS OF PITCH CYLINDER (MM)
C... RBT2.....RADIUS OF BASE CYLINDER (MM)
C... RAT2.....RADIUS OF ADDENDUM CYLINDER (MM)
C... RDT2.....RADIUS OF DEDENDUM CYLINDER (MM)
C... PSIT2.....TRANSVERSE PRESSURE ANGLE (RAD.)
C... LAMDB2.....HELIX ANGLE ON BASE CYLINDER (RAD.)
    TN2=100.D0
    PN2=5.D0/25.4D0
    A11=DACOS(-1.D0)/180.D0
    PSIN2=A11*20.D0
    LAMDP2=A11*60.D0
    BETAP2=A11*30.D0
    FW2=25.4D0*1.6D0
    ADG2=1.D0/PN2
    DEG2=1.25D0/PN2
    IF(KHD.EQ.2) THEN
        LAMDP1=-LAMDP1
        BETAP1=-BETAP1
        LAMDP2=-LAMDP2
        BETAP2=-BETAP2
    ENDIF
    CALL DATAT1
    CALL DATAT2
C... THE FOLLOWING IS FOR CONTROLLING PARAMETERS
C... AA... MODIFICATION PARAMETER OF GEAR
C... AP... MODIFICATION PARAMETER OF PINION RACK-CUTTER
C... DP...TANGENT POINT N OF PROFILES OF PINION & GEAR RACK-CUTTERS
C... THET2P..INITIAL ANGLE FOR MODIFICATION OF GEAR (RAD.)
C
C    PARAMETERS FOR TCA
C

```

```

C.. KM .. SWITCH 1 FOR CROSSING & 2 FOR INTERSECTING MISALIGNMENT
C.. DGAM..ANGLE OF DISALIGNMENT(CROSSING OR INTERSECTING) (ARC MINUTE)
C.. DEE... CHANGE OF CENTER DISTANCE (MM)
    KM=1
C    KM=2
    DGAM=0.D0
    DEE=0.000D0
    AA=-0.0014D0
    THET2P=-0.08D0
    AP=-0.0008
    DP=-DSIN(PSIN1)*DCOS(-1.D0)*RPT1/TN1/8.D0
C... THE INPUT BLOCK IS OVER HERE
C
C... OUPTPUT DATA FILES ARE THE FOLLOWINGS
C
C... FILE 55... TOOTH PROPORTIONS OF PINION AND GEAR
C... FILE 85... CONTACT PATH ON PINION SURFACE (2D)
C... FILE 86... CONTACT PATH ON GEAR SURFACE (2D)
C... FILE 87... DIRECTIONS OF LONG AXIS OF CONTACT ELLIPS (2D)
C... FILE 90 ...TRANSMISSION ERRORS
    DO 901 I=1,3
        UI(I)=0.D0
        UJ(I)=0.D0
        UK(I)=0.D0
901 CONTINUE
    UI(1)=1.D0
    UJ(2)=1.D0
    UK(3)=1.D0
C .. EE2..... GEAR RATIO
    EE2=TN1/TN2
C .. CC..... CENTER DISTANCE OF GEAR DRIVE
    CC=RPT1+RPT2+DEE
C .. CALCULATE CONTACT POINT ON MEAN SECTION WITHOUT MISALIGNMENT
    ICONT=1
    N=6
    ERRREL=0.1D-6
    ITMAX=1000
C
    CALL MIAL(KM,0.D0,LFH)
C
    XI(1)=0.D0
    XI(2)=0.D0
    XI(3)=0.D0
    XI(4)=0.D0
    XI(5)=0.D0
    XI(6)=0.D0
    DD=0.D0
C
    CALL DNEQNF(FCNG,ERRREL,N,ITMAX,XI,X,FNORM)
C
    PHISS1=X(6)
    PHI1MEA=X(6)
C .. CALCULATE CONTACT POINT ON EDGE SECTION WITHOUT MISALIGNMENT
    DD=-0.5D0*FW1
    ERRREL=0.1D-8
C
    CALL DNEQNF(FCNG,ERRREL,N,ITMAX,XI,X,FNORM)
C
    PHISS2=X(6)
C .. CALCULATE CONTACT POINT ON EDGE SECTION WITH MISALIGNMENT

```

```

N=6
ERRREL=0.1D-6
ITMAX=1000
C
CALL MIAL(KM,DGAM,LFH)
C
XI(1)=X(1)
XI(2)=X(2)
XI(3)=X(3)
XI(4)=X(4)
XI(5)=X(5)
XI(6)=X(6)
C
CALL DNEQNF(FCNG,ERRREL,N,ITMAX,XI,X,FNORM)
C
1330 CONTINUE
PHI1=X(6)
PHI1STA=X(6)
C .. THE FOLLOWING IS FOR TCA
ICONT=2
N=5
ERRREL=0.1D-5
ITMAX=400
STP=(PHISS2-PHISS1)/36.D0
NN=72
DO 1010 I=1,NN
    PHI1=PHI1STA-(I-1)*STP
    XI(1)=X(1)
    XI(2)=X(2)
    XI(3)=X(3)
    XI(4)=X(4)
    XI(5)=X(5)
C
CALL DNEQNF(FCNG,ERRREL,N,ITMAX,XI,X,FNORM)

IF(RG1(3).GT.(0.5D0*FW1)) GO TO 1011
C... ROTATING VELOCITY OF CUTTER IN CUTTER SYSTEM
W1(1)=0.D0
W1(2)=0.D0
W1(3)=0.D0
C... ROTATING VELOCITY OF PINION IN CUTTER SYSTEM
W2(1)=0.D0
W2(2)=0.D0
W2(3)=1.D0
C... NORMAL OF CUUTER IN CUTTER SYSTEM
EX(1)=XNP1
EX(2)=YNP1
EX(3)=ZNP1
C... TRANSFER VELOCITIES OF CUTTER AND PINION IN CUTTER SYSTEM
CALL EQVEC(VT1,VT11)
CALL EQVEC(VT2,VT12)
C... RELATIVE VELOCITIS OF CUTTER WRT. PINION IN CUTTER SYSTEM
CALL ADDVEC(W12,W1,W2,-1.D0)
CALL ADDVEC(V12,VT1,VT2,-1.D0)
KF=KFP
KH=KHP
C... PRINCIPAL CURVATUTES AND DIRECTIONS OF PINION
CALL CURVT(1)
C... PRINCIPAL DIRECTIONS OF PINION IN PINION SYSTEM
CALL EQVEC(EFF,ES)

```

```

      CALL EQVEC(EHH,EQ)
C... ROTATING VELOCITY OF CUTTER IN CUTTER SYSTEM
      W1(1)=0.D0
      W1(2)=0.D0
      W1(3)=0.D0
C... ROTATING VELOCITY OF GEAR IN CUTTER SYSTEM
      W2(1)=0.D0
      W2(2)=0.D0
      W2(3)=-DGPHI2
C... NORMAL OF CUUTER IN CUTTER SYSTEM
      EX(1)=XNP2
      EX(2)=YNP2
      EX(3)=ZNP2
C... TRANSFER VELOCITIES OF CUTTER AND PINION
      CALL EQVEC(VT1,VT21)
      CALL EQVEC(VT2,VT22)
      CALL EQVEC(EF,EF2)
      CALL EQVEC(EH,EH2)
      KF=KF2
      KH=KH2
C... RELATIVE VELOCITIS OF CUTTER WRT. GEAR IN CUTTER SYSTEM
      CALL ADDVEC(W12,W1,W2,-1.D0)
      CALL ADDVEC(V12,VT1,VT2,-1.D0)
      KF=KFG
      KH=KHG
C... PRINCIPAL CURVATUTES AND DIRECTIONS OF PINION
      CALL CURVT(2)
C... PRINCIPAL DIRECTIONS OF PINION IN PINION SYSTEM
      CALL TRANSM(L1F,LF1)
      CALL MAVEC(V1,LH2,ES)
      CALL MAVEC(V2,LFH,V1)
      CALL MAVEC(ES,L1F,V2)
      CALL MAVEC(V1,LH2,EQ)
      CALL MAVEC(V2,LFH,V1)
      CALL MAVEC(EQ,L1F,V2)
C... CONTACT ELLIPSES
      CALL ELLIP
      ELAL(I)=A
C... AXIS OF PINION ELLIPSE ON TANGENT PLANE
      CALL EQVEC(V1,SI)
      CALL DOTVEC(V1N,V1,V1)
      EL1(1,I)=DSQRT(V1(1)**2+V1(2)**2/V1N)
      EL1(2,I)=V1(3)/DSQRT(V1N)
C... AXIS OF GEAR ELLIPSE ON TANGENT PLANE
      CALL TRANSM(LHF,LFH)
      CALL TRANSM(L2H,LH2)
      CALL MAVEC(V2,LF1,V1)
      CALL MAVEC(V1,LHF,V2)
      CALL MAVEC(V2,L2H,V1)
      CALL EQVEC(V1,V2)
      CALL DOTVEC(V1N,V1,V1)
      EL2(1,I)=-DSQRT(V1(1)**2+V1(2)**2/V1N)
      EL2(2,I)=V1(3)/DSQRT(V1N)
      AG1=DATAN(EL1(2,I)/EL1(1,I))/A11
      AG2=DATAN(EL2(2,I)/EL2(1,I))/A11
      DPHI(1,I)=PHI1
      DPHI(2,I)=PHI2-TN1/TN2*PHI1
      DDR1=DSQRT(RG1(1)**2+RG1(2)**2)
      DDR2=DSQRT(RG2(1)**2+RG2(2)**2)-210.D0
      KM=4

```



```

        OU1=FLOAT(I-1)/FLOAT(KM)
        OUP=AIN(T(OU1))
        IF(OU1.EQ.OUP) THEN
            WRITE(85,*) DDR1, RG1(3)
            WRITE(86,*) DDR2, RG2(3)
C         WRITE(87,*) ELAL(I), EL1(1,I), EL1(2,I), EL2(1,I), EL2(2,I)
        ENDIF
1010 CONTINUE
1011 CONTINUE
        AD=-10000.DO
        DO 1090 I=1, NN, KM
            IF(DPHI(2,I).NE.0.DO) THEN
                IF(DPHI(2,I).GT.AD) THEN
                    AD=DPHI(2,I)
                ENDIF
            ENDIF
1090 CONTINUE
        SS=360.DO/TN1
        DO 1020 J=1, 4
            DO 1030 I=1, NN, KM
                BD=(DPHI(2,I)-AD)/A11*3600.DO
                DDPHI(1,I,J)=DPHI(1,I)/A11+SS*(J-1)
                DDPHI(2,I,J)=BD
1030 CONTINUE
1020 CONTINUE
            KM=4
            DO 1040 J=1, 4
                DO 1050 I=1, NN, KM
                    IF(DDPHI(1,I,J).NE.0.DO) THEN
                        WRITE(90,*) DDPHI(1,I,J), DDPHI(2,I,J)
                    ENDIF
1050 CONTINUE
1040 CONTINUE
            KM=4
            DO 1060 I=1, NN, KM
                WRITE(87,*) ELAL(I), EL1(1,I), EL1(2,I), EL2(1,I), EL2(2,I)
1060 CONTINUE
        WRITE(6,*) '***** PROGRAM FINISHED *****'
        STOP
        END

```

C
C ...THE SUBROUTINE IS FOR TCA
C...

```

SUBROUTINE FCNG(X,F,N)
IMPLICIT REAL*8(A-H,O-Z)
REAL*8 X(N), F(N)
REAL*8 LF1(3,3), LH2(3,3), LFH(3,3)
REAL*8 R1F(3), R2F(3), N1F(3), N2F(3), CO(3)
REAL*8 AVC1(3), VTR1(3), AVC2(3), VTR2(3)
REAL*8 UI(3), UJ(3), UK(3), V1(3), V2(3), V3(3), V4(3), V5(3)
REAL*8 UP, LAMDP, LAMDB
REAL*8 KF2, KH2
REAL*8 KFP, KHP, KFG, KHG
COMMON /AXIS/ UI, UJ, UK
COMMON /SG1/ RG1, NG1, AP, DP
COMMON /SG2/ RG2, NG2, AA
COMMON /ATT/ PHI1, PHI2, R1F, R2F, N1F, N2F, LFH, CC, DGAM, DPHI2
COMMON /AST/ ICONT
COMMON /MVT/ LF1, LH2
REAL*8 KSIG1, KSIG2, KFF, KHH

```

```

REAL*8 EFN(3), EHN(3), W1VT2(3), WV12(3), W2VT1(3), KF, KH, KS, KQ
REAL*8 KM2, KT2
COMMON /A300/ ES(3), EQ(3)
COMMON /A310/ KFF, KHH
COMMON /A340/ EFF(3), EHH(3)
COMMON /A340/ EF1(3), EH1(3)
COMMON /A360/ A, B, SI(3), FI(3)
COMMON /A200/ W1(3), W2(3), W12(3), VT1(3), VT2(3), V12(3)
COMMON /A210/ EX(3), EF(3), EH(3)
COMMON /A212/ EF2(3), EH2(3), KF2, KH2
COMMON /A220/ KF, KH
COMMON /A230/ ET(3), EM(3)
COMMON /A380/ KS, KQ
COMMON /A400/ VT11(3), VT12(3), VT21(3), VT22(3)
COMMON /A401/ KHP, KFP, KHG, KFG
REAL*8 RG1(3), NG1(3)
REAL*8 RG2(3), NG2(3)
REAL*8 LAMDP2, LAMDB2
REAL*8 LAMDP1, LAMDB1
COMMON /DATT2/ TN2, PN2, PSIN2, BETAP2, ADG2, DEG2, LAMDP2,
& UP2, FW2, RPT2, RBT2, RAT2, RDT2, PSIT2, LAMDB2
COMMON /B2/XNP1, YNP1, ZNP1, XNP2, YNP2, ZNP2
COMMON /B4/X1, Y1, Z1, XN1, YN1, ZN1
COMMON /B5/X2, Y2, Z2, XN2, YN2, ZN2
COMMON /B6/THET2P, DGPHI2
COMMON /W1/ ETAW1, UPP1, SPP1, ETAW2, UPP2, SPP2
COMMON /NET/ RR, DD
COMMON /DATT/ TN1, PN1, PSIN1, BETAP1, ADG1, DEG1, LAMDP1,
& FW1, RPT1, RBT1, RAT1, RDT1, PSIT1, LAMDB1
UPP1=X(1)
ETAW1=X(2)
UPP2=X(3)
ETAW2=X(4)
PHI2=X(5)
IF(ICONT.EQ.1) THEN
    PHI1=X(6)
ENDIF
RPT=RPT1
CNST=DARCOS(-1.0D00)/180.0
PI=DARCOS(-1.0D00)
PI2=2.0D0*PI
PSIT= PSIT1
PSIN= PSIN1
BETAP= BETAP1
DSIN1=DSIN(ETAW1)
DCOS1=DCOS(ETAW1)
ANF1=DARCOS(RBT1/RPT1)
CINV1=DTAN(ANF1)-ANF1
ANG1=PI/2.0D0/TN1
AM=PI/PN1/4.0D0
SA=AM*DCOS(BETAP)
SS1= RPT1*(ETAW1)
DSS1= RPT1
C... EQUATION OF MESHING OF PINION
FF1=SPP1*DSIN(BETAP)
FF2=(-(UPP1+DP)-2.0D0*AP**2*UPP1**3)
FF3=DSIN(PSIN)+2.0D0*AP*UPP1*DCOS(PSIN)
F5=FF2/FF3*DCOS(BETAP)-SA-RPT1*ETAW1
SPP1= F5/DSIN(BETAP)
C... SURFACE OF PINION RACK CUTTER

```

```

XP=(UPP1+DP)*DCOS(PSIN)
YP=((UPP1+DP)*DSIN(PSIN)+AM)*DCOS(BETAP)+
& AP*UPP1**2*DCOS(PSIN)*DCOS(BETAP)+SPP1*DSIN(BETAP)
ZP=-((UPP1+DP)*DSIN(PSIN)+AM)*DSIN(BETAP)-
& AP*UPP1**2*DCOS(PSIN)*DSIN(BETAP)+SPP1*DCOS(BETAP)
X1=DCOS(ETAW1)*XP+DSIN(ETAW1)*YP+RPT1*DCOS(ETAW1)
&+SS1*DSIN(ETAW1)
Y1=-DSIN(ETAW1)*XP+DCOS(ETAW1)*YP-RPT1*DSIN(ETAW1)
&+SS1*DCOS(ETAW1)
Z1=ZP
C... NORMAL OF RACK CUTTER
PNN=DSQRT(1.D0+(2.D0*AP*UPP1)**2)
XNPP=-2.D0*AP*UPP1/PNN
YNPP=1.D0/PNN
ZNPP=0.D0
XNP1=(DCOS(PSIN)*XNPP-DSIN(PSIN)*YNPP)
YNP1=(DSIN(PSIN)*DCOS(BETAP)*XNPP+DCOS(PSIN)*DCOS(BETAP)*YNPP)
ZNP1=(-DSIN(PSIN)*DSIN(BETAP)*XNPP-DCOS(PSIN)*DSIN(BETAP)*YNPP)
C .. NORMAL OF PINION IN S1
XN1=DCOS(ETAW1)*XNP1+DSIN(ETAW1)*YNP1
YN1=-DSIN(ETAW1)*XNP1+DCOS(ETAW1)*YNP1
ZN1=ZNP1
DX1=-DSIN(ETAW1)*XP+DCOS(ETAW1)*YP+SS1*DCOS(ETAW1)
DY1=-DCOS(ETAW1)*XP-DSIN(ETAW1)*YP-SS1*DSIN(ETAW1)
DZ1=0.D0
RG1(1)=X1
RG1(2)=Y1
RG1(3)=Z1
NG1(1)=XN1
NG1(2)=YN1
NG1(3)=ZN1
KHP=0.D0
KFP=2.D0*AP/(DSQRT((1.D0+(2.D0*AP*UPP1)**2))**3)
EF1(1)=DCOS(PSIN)
EF1(2)=DSIN(PSIN)*DCOS(BETAP)
EF1(3)=-DSIN(PSIN)*DSIN(BETAP)
EH1(1)=0.D0
EH1(2)=DSIN(BETAP)
EH1(3)=DCOS(BETAP)
EF(1)=DCOS(ETAW1)*EH1(1)+DSIN(ETAW1)*EH1(2)
EF(2)=-DSIN(ETAW1)*EH1(1)+DCOS(ETAW1)*EH1(2)
EF(3)=EH1(3)
EH(1)=DCOS(ETAW1)*EF1(1)+DSIN(ETAW1)*EF1(2)
EH(2)=-DSIN(ETAW1)*EF1(1)+DCOS(ETAW1)*EF1(2)
EH(3)=EF1(3)
C VELOCITY OF RACK-CUTTER IN SP
VT11(1)=0.D0
VT11(2)=RPT1
VT11(3)=0.D0
C VELOCITY OF PINION IN SP
VT12(1)=-(YP+SS1)
VT12(2)=XP+RPT1
VT12(3)=0.D0
RPT=RPT2
PSIT=PSIT2
PSIN=PSIN2
BETAP=BETAP2
SS2=RPT2*(ETAW2/TN2*TN1)
DSS2=RPT2/TN2*TN1
TTD=AA*(ETAW2-THET2P)**2

```

```

DTP=2.D0*AA*(ETAW2-THET2P)
GPHI2= ETAW2/TN2*TN1-TTD
DGPHI2= 1.D0/TN2*TN1-DTP
C... EQUATION OF MESHING OF GEAR
GG1=SPP2*DSIN(PSIN2)*DSIN(BETAP2)
GG1=DSIN(PSIN2)*DSIN(BETAP2)
GG2=(UPP2+DP)*DCOS(BETAP2)
GG3= RPT2*TN1/TN2*ETAW2*DSIN(PSIN2)
GG4=SA*DSIN(PSIN2)
GG5= 2.D0*AA*TN2*(ETAW2-THET2P)*RPT2*DCOS(PSIN2)*DCOS(BETAP2)
GG6= TN1-2.D0*AA*TN2*(ETAW2-THET2P)
SPP2=-(GG2+GG3+GG4+GG5/GG6)/GG1
C... SURFACE OF GEAR RACK CUTTER
XP=(UPP2+DP)*DCOS(PSIN)
YP=((UPP2+DP)*DSIN(PSIN)+AM)*DCOS(BETAP)+SPP2*DSIN(BETAP)
ZP=-((UPP2+DP)*DSIN(PSIN)+AM)*DSIN(BETAP)+SPP2*DCOS(BETAP)
X2=-DCOS(GPHI2)*XP+DSIN(GPHI2)*YP+RPT2*DCOS(GPHI2)
&+SS2*DSIN(GPHI2)
Y2=-DSIN(GPHI2)*XP-DCOS(GPHI2)*YP+RPT2*DSIN(GPHI2)
&-SS2*DCOS(GPHI2)
Z2=ZP
C... NORMAL OF RACK CUTTER IN SW
XNP2=DSIN(PSIN)
YNP2=-DCOS(PSIN)*DCOS(BETAP)
ZNP2= DCOS(PSIN)*DSIN(BETAP)
XNP2=-DSIN(PSIN)
YNP2= DCOS(PSIN)*DCOS(BETAP)
ZNP2=-DCOS(PSIN)*DSIN(BETAP)
C .. NORMAL OF GEAR IN S2
XN2=-DCOS(GPHI2)*XNP2+DSIN(GPHI2)*YNP2
YN2=-DSIN(GPHI2)*XNP2-DCOS(GPHI2)*YNP2
ZN2= ZNP2
DX2=(DSIN(GPHI2)*XP+DCOS(GPHI2)*YP-RPT2*DSIN(GPHI2)+
&SS2*DCOS(GPHI2))*DGPHI2+DSS2*DSIN(GPHI2)
DY2=(-DCOS(GPHI2)*XP+DSIN(GPHI2)*YP+RPT2*DCOS(GPHI2)+
&SS2*DSIN(GPHI2))*DGPHI2-DSS2*DCOS(GPHI2)
DZ2=0.D0
RG2(1)=X2
RG2(2)=Y2
RG2(3)=Z2
NG2(1)=XN2
NG2(2)=YN2
NG2(3)=ZN2
KFG=0.D0
KHG=0.D0
EF2(1)=DCOS(PSIN)
EF2(2)=DSIN(PSIN)*DCOS(BETAP)
EF2(3)=-DSIN(PSIN)*DSIN(BETAP)
EH2(1)=0.D0
EH2(2)= DSIN(BETAP)
EH2(3)= DCOS(BETAP)
C VELOCITY OF RACK-CUTTER IN SG
VT21(1)=0.D0
VT21(2)= RPT1
VT21(3)=0.D0
C VELOCITY OF GEAR
VT22(1)=- (YP+SS2)*DGPHI2
VT22(2)= (XP+RPT2)*DGPHI2
VT22(3)=0.D0
S1=DSIN(PHI1)

```

```

C1=DCOS(PHI1)
S2=DSIN(PHI2)
C2=DCOS(PHI2)
LF1(1,1)=C1
LF1(1,2)=S1
LF1(2,1)=-S1
LF1(2,2)=C1
LF1(1,3)=0.D0
LF1(2,3)=0.D0
LF1(3,1)=0.D0
LF1(3,2)=0.D0
LF1(3,3)=1.D0
LH2(1,1)=C2
LH2(1,2)=-S2
LH2(2,1)=S2
LH2(2,2)=C2
LH2(1,3)=0.D0
LH2(2,3)=0.D0
LH2(3,1)=0.D0
LH2(3,2)=0.D0
LH2(3,3)=1.D0
CALL MAVEC(V1,LH2,NG2)
CALL MAVEC(N2F,LFH,V1)
CALL MAVEC(V2,LH2,RG2)
CALL MAVEC(V3,LFH,V2)
CALL ADDVEC(R2F,V3,UI,CC)
CALL MAVEC(N1F,LF1,NG1)
CALL MAVEC(R1F,LF1,RG1)
F(1)=(R1F(1)-R2F(1))
F(2)=(R1F(2)-R2F(2))
F(3)=(R1F(3)-R2F(3))
F(4)=N1F(1)-N2F(1)
F(5)=N1F(2)-N2F(2)
IF(ICONT.EQ.1) THEN
  F(6)=Z1-DD
ENDIF
RETURN
END

```

C...

C... FOR PINION DATA **

C...

```

SUBROUTINE DATAT1
IMPLICIT REAL*8(A-H,O-Z)
REAL*8 UP,LAMDP1,LAMDB1
COMMON /DATT/ TN1,PN1,PSIN1,BETAP1,ADG1,DEG1,LAMDP1,
& FW1,RPT1,RBT1,RAT1,RDT1,PSIT1,LAMDB1
RPT1=TN1/(2.D0*PN1*DCOS(BETAP1))
PSIT1=DATAN(DTAN(PSIN1)/DCOS(BETAP1))
RBT1=RPT1*DCOS(PSIT1)
RAT1=RPT1+ADG1
RDT1=RPT1-DEG1
LAMDB1=DATAN(DTAN(LAMDP1)/DCOS(PSIT1))
BETAB1=DATAN(DTAN(BETAP1)*DCOS(PSIT1))
WRITE(55,110)

```

```

110 FORMAT(/2X,'*****',/
& 2X,'* DATA OF PINION *',/
& 2X,'*****',/)
WRITE(55,120) TN1,PN1,PSIN1,BETAP1,ADG1,DEG1,LAMDP1,FW1,
& RPT1,RBT1,RAT1,RDT1,PSIT1,LAMDB1
120 FORMAT(2X,'GEAR NUMBER OF TEETH TN1=',F14.7/

```

```

&2X,'NORMAL DIAMETRAL PITCH (1/MM)      PN1=',F14.7/
&2X,'NORMAL PRESSURE ANGLE (RAD.)      PSIN1=',F14.7/
&2X,'LEADING ANGLE OF HELIX'          /
&4X,'ON PITCH CYLINDER (RAD.)      BETAP1=',F14.7/
&2X,'ADDENDUM (MM)      ADG1=',F14.7/
&2X,'DEDENDUM (MM)      DEG1=',F14.7/
&2X,'HELIX ANGLE ON PITCH CYLINDER(RAD) LAMDP1=',F14.7/
&2X,'FACE WIDTH (MM)      FW1=',F14.7/
&2X,'RADIUS OF PITCH CYLINDER (MM)      RPT1=',F14.7/
&2X,'RADIUS OF BASE CYLINDER (MM)      RBT1=',F14.7/
&2X,'RADIUS OF ADDENDUM CYLINDER (MM)      RAT1=',F14.7/
&2X,'RADIUS OF DEDENDUM CYLINDER (MM)      RDT1=',F14.7/
&2X,'TRANSVERSE PRESSURE ANGLE (RAD>      PSIT1=',F14.7/
&2X,'HELIX ANGLE ON BASE CYLINDER (RAD) LAMDB1=',F14.7/)

C...
    RETURN
    END

C...
C ...THE SUBROUTINE IS FOR DATA OF THEORITICAL GEAR SURFACE
C...
    SUBROUTINE DATAT2
    IMPLICIT REAL*8(A-H,O-Z)
    REAL*8 UP2,LAMDP2,LAMDB2
    COMMON /DATT2/ TN2,PN2,PSIN2,BETAP2,ADG2,DEG2,LAMDP2,
& UP2,FW2,RPT2,RBT2,RAT2,RDT2,PSIT2,LAMDB2
    RPT2=TN2/(2.D0*PN2*DCOS(BETAP2))
    PSIT2=DATAN(DTAN(PSIN2)/DCOS(BETAP2))
    RBT2=RPT2*DCOS(PSIT2)
    RAT2=RPT2+ADG2
    RDT2=RPT2-DEG2
    LAMDB2=DATAN(DTAN(LAMDP2)/DCOS(PSIT2))
    BETAB2=DATAN(DTAN(BETAP2)*DCOS(PSIT2))
    DEL2=0.007
C    WRITE(6,110)
    WRITE(55,110)
110  FORMAT(/2X,'*****',/
&      2X,'*          DATA OF GEAR 2          *',/
&      2X,'*****',/)
    WRITE(55,120) TN2,PN2,PSIN2,BETAP2,ADG2,DEG2,LAMDP2,
&      FW2,RPT2,RBT2,RAT2,RDT2,PSIT2,LAMDB2,DEL2
120  FORMAT(2X,'GEAR NUMBER OF TEETH          TN2=',F14.7/
&2X,'NORMAL DIAMETRAL PITCH (1/MM)      PN2=',F14.7/
&2X,'NORMAL PRESSURE ANGLE (RAD.)      PSIN2=',F14.7/
&2X,'LEADING ANGLE OF HELIX'          /
&4X,'ON PITCH CYLINDER (RAD.)      BETAP2=',F14.7/
&2X,'ADDENDUM (MM)      ADG2=',F14.7/
&2X,'DEDENDUM (MM)      DEG2=',F14.7/
&2X,'HELIX ANGLE ON PITCH CYLINDER(RAD) LAMDP2=',F14.7/
&2X,'FACE WIDTH (MM)      FW2=',F14.7/
&2X,'RADIUS OF PITCH CYLINDER (MM)      RPT2=',F14.7/
&2X,'RADIUS OF BASE CYLINDER (MM)      RBT2=',F14.7/
&2X,'RADIUS OF ADDENDUM CYLINDER (MM)      RAT2=',F14.7/
&2X,'RADIUS OF DEDENDUM CYLINDER (MM)      RDT2=',F14.7/
&2X,'TRANSVERSE PRESSURE ANGLE (RAD.)      PSIT2=',F14.7/
&2X,'HELIX ANGLE ON BASE CYLINDER(RAD) LAMDB2=',F14.7/
&2X,'ELASTIC APPROACH (MM)      DEL=',F14.7)

C...
    RETURN
    END

C...

```

C... ADDITION OF TWO VECTORS

```
C...
  SUBROUTINE ADDVEC(VA,VB,VC,DD)
  IMPLICIT REAL*8 (A-H,O-Z)
  REAL*8 VA(3),VB(3),VC(3)
  DO 101 I=1,3
    VA(I)=VB(I)+DD*VC(I)
101 CONTINUE
  RETURN
  END
```

C...

C... DOT PRODUCT OF TWO VECTOR

```
C...
  SUBROUTINE DOTVEC(AA,VA,VB)
  IMPLICIT REAL*8(A-H,O-Z)
  REAL*8 VA(3),VB(3)
  AA=0.D0
  DO 102 I=1,3
    AA=AA+VA(I)*VB(I)
102 CONTINUE
  RETURN
  END
```

C...

C... CROSS PRODUCT OF TWO VECTOR

```
C...
  SUBROUTINE CROVEC(VA,VB,VC)
  IMPLICIT REAL*8(A-H,O-Z)
  REAL*8 VA(3),VB(3),VC(3)
  VA(1)=VB(2)*VC(3)-VB(3)*VC(2)
  VA(2)=VB(3)*VC(1)-VB(1)*VC(3)
  VA(3)=VB(1)*VC(2)-VB(2)*VC(1)
  RETURN
  END
```

C...

C... PRODUCT OF MATRIX AND A VECTOR

```
C...
  SUBROUTINE MAVEC(VA,MC,VB)
  IMPLICIT REAL*8(A-H,O-Z)
  REAL*8 MC(3,3),VA(3),VB(3)
  DO 103 I=1,3
    VA(I)=0.0
    DO 104 J=1,3
      VA(I)=MC(I,J)*VB(J)+VA(I)
104 CONTINUE
103 CONTINUE
  RETURN
  END
```

C...

C... PRODUCT OF A VECTOR AND A SCALAR

```
C...
  SUBROUTINE PDSVEC(VA,VB,T)
  IMPLICIT REAL*8 (A-H,O-Z)
  REAL*8 VA(3),VB(3)
  DO 105 I=1,3
    VA(I)=T*VB(I)
105 CONTINUE
  RETURN
  END
```

C...

C... STANDARDIZATION OF A VECTOR

```

C...
SUBROUTINE STDVEC(VA,VB)
IMPLICIT REAL*8 (A-H,O-Z)
REAL*8 VA(3),VB(3)
CC=0.D0
DO 106 I=1,3
    CC=CC+VB(I)**2
106 CONTINUE
CN=DSQRT(CC)
DO 107 I=1,3
    VA(I)=VB(I)/CN
107 CONTINUE
RETURN
END

C...
C... INPUT A VECTOR TO ANOTHER VECTOR
C...
SUBROUTINE EQVEC(VA,VB)
IMPLICIT REAL*8 (A-H,O-Z)
REAL*8 VA(3),VB(3)
DO 108 I=1,3
    VA(I)=VB(I)
108 CONTINUE
RETURN
END

C...
C... TRIPLE PRODUCT OF THREE VECTORS
C...
SUBROUTINE TRIVEC(AA,VA,VB,VC)
IMPLICIT REAL*8 (A-H,O-Z)
REAL*8 VA(3),VB(3),VC(3),V(3)
CALL CROVEC(V,VB,VC)
CALL DOTVEC(AA,VA,V)
RETURN
END

C...
C... TRANSFOR MATRIX
C...
SUBROUTINE TRANSM(AA,BB)
IMPLICIT REAL*8 (A-H,O-Z)
REAL*8 AA(3,3),BB(3,3)
AA(1,1)=BB(1,1)
AA(1,2)=BB(2,1)
AA(1,3)=BB(3,1)
AA(2,1)=BB(1,2)
AA(2,2)=BB(2,2)
AA(2,3)=BB(3,2)
AA(3,1)=BB(1,3)
AA(3,2)=BB(2,3)
AA(3,3)=BB(3,3)
RETURN
END

C...
C... PRODUCT OF TWO MATRICES
C...
SUBROUTINE MAPMA(AA,BB,CC)
IMPLICIT REAL*8 (A-H,O-Z)
REAL*8 AA(3,3),BB(3,3),CC(3,3)
AA(1,1)=BB(1,1)*CC(1,1)+BB(1,2)*CC(2,1)+BB(1,3)*CC(3,1)
AA(1,2)=BB(1,1)*CC(1,2)+BB(1,2)*CC(2,2)+BB(1,3)*CC(3,2)

```



```

AA(1,3)=BB(1,1)*CC(1,3)+BB(1,2)*CC(2,3)+BB(1,3)*CC(3,3)
AA(2,1)=BB(2,1)*CC(1,1)+BB(2,2)*CC(2,1)+BB(2,3)*CC(3,1)
AA(2,2)=BB(2,1)*CC(1,2)+BB(2,2)*CC(2,2)+BB(2,3)*CC(3,2)
AA(2,3)=BB(2,1)*CC(1,3)+BB(2,2)*CC(2,3)+BB(2,3)*CC(3,3)
AA(3,1)=BB(3,1)*CC(1,1)+BB(3,2)*CC(2,1)+BB(3,3)*CC(3,1)
AA(3,2)=BB(3,1)*CC(1,2)+BB(3,2)*CC(2,2)+BB(3,3)*CC(3,2)
AA(3,3)=BB(3,1)*CC(1,3)+BB(3,2)*CC(2,3)+BB(3,3)*CC(3,3)
RETURN
END

```

C..

```

C... THE SUBROUTINE IS FOR MISALIGNMENT
SUBROUTINE MIAL(K,DGAMM,LFH)
IMPLICIT REAL*8(A-H,O-Z)
REAL*8 LFH(3,3)
S3=DSIN(DGAMM)
C3=DCOS(DGAMM)

```

C ** FOR CROSSING ANGLE MISALIGNMENT

```

IF(K.EQ.1) THEN
  LFH(1,1)=-1.D0
  LFH(1,2)=0.D0
  LFH(1,3)=0.D0
  LFH(2,1)=0.D0
  LFH(2,2)=-C3
  LFH(2,3)=-S3
  LFH(3,1)=0.D0
  LFH(3,2)=-S3
  LFH(3,3)=C3

```

ENDIF

C ** FOR INTERSECTING ANGLE MISALIGNMENT

```

IF(K.EQ.2) THEN
  LFH(1,1)=-C3
  LFH(1,2)=0.D0
  LFH(1,3)=S3
  LFH(2,1)=0.D0
  LFH(2,2)=-1.D0
  LFH(2,3)=0.D0
  LFH(3,1)=S3
  LFH(3,2)=0.D0
  LFH(3,3)=C3

```

ENDIF

C

```

RETURN
END

```

C

C COMPUTE THE PRINCIPAL CURVATURES OF MODIFIED cutter SURFACE

C

```

SUBROUTINE CURVT(KK)
IMPLICIT REAL*8(A-H,O-Z)
REAL*8 EFN(3),EHN(3),W1VT2(3),WV12(3),W2VT1(3),KF,KH,KS,KQ
REAL*8 KM2,KT2,KFF,KHH
COMMON/A200/ W1(3),W2(3),W12(3),VT1(3),VT2(3),V12(3)
COMMON /A210/ EX(3),EF(3),EH(3)
COMMON /A220/ KF,KH
COMMON /A230/ ET(3),EM(3)
COMMON /A300/ ES(3),EQ(3)
COMMON /A310/ KFF,KHH
COMMON /A380/ KS,KQ
EFN(1)= EX(2)*EF(3)-EX(3)*EF(2)
EFN(2)=-(EX(1)*EF(3)-EX(3)*EF(1))
EFN(3)= EX(1)*EF(2)-EX(2)*EF(1)

```

```

EHN(1)= EX(2)*EH(3)-EX(3)*EH(2)
EHN(2)=- (EX(1)*EH(3)-EX(3)*EH(1))
EHN(3)= EX(1)*EH(2)-EX(2)*EH(1)
W1VT2(1)= W1(2)*VT2(3)-W1(3)*VT2(2)
W1VT2(2)=- (W1(1)*VT2(3)-W1(3)*VT2(1))
W1VT2(3)= W1(1)*VT2(2)-W1(2)*VT2(1)
W2VT1(1)= W2(2)*VT1(3)-W2(3)*VT1(2)
W2VT1(2)=- (W2(1)*VT1(3)-W2(3)*VT1(1))
W2VT1(3)= W2(1)*VT1(2)-W2(2)*VT1(1)
WV12(1)= W12(2)*V12(3)-W12(3)*V12(2)
WV12(2)=- (W12(1)*V12(3)-W12(3)*V12(1))
WV12(3)= W12(1)*V12(2)-W12(2)*V12(1)
V12F=0.0
V12H=0.0
WNEF=0.0
WNEH=0.0
VWN= 0.0
W1TN=0.0
W2TN=0.0
DO 1 I=1,3
    V12F= V12(I)*EF(I)+V12F
    V12H= V12(I)*EH(I)+V12H
    WNEF= W12(I)*EFN(I)+WNEF
    WNEH= W12(I)*EHN(I)+WNEH
    VWN = EX(I)*WV12(I)+VWN
    W1TN= EX(I)*W1VT2(I)+W1TN
1    W2TN= EX(I)*W2VT1(I)+W2TN
C... COMPUTE THE CURVATURE OF THE GENERATED SURFACE
    B13=-KF*V12F-WNEF
    B23=-KH*V12H-WNEH
    B33=-KF*V12F**2-KH*V12H**2+VWN-W1TN+W2TN
    B11=B13**2/B33
    B12=B13*B23/B33
    B22=B23**2/B33
    T1=2.0D00*B13*B23
    T2=B23**2-B13**2-(KF-KH)*B33
    SIG1F=0.5D00*DATAN(T1/T2)
C....PRINCIPAL CURVATURES OF THE GENERATED SURFACE
    IF(DABS(SIG1F).LE.0.1D-5) THEN
        KQ=0.5D0*((KF+KH)+(B13**2+B23**2)/B33
        &      +(B23**2-B13**2-(KF-KH)*B33)/(B33*DCOS(SIG1F)))
        KS=KQ-(B23**2-B13**2-(KF-KH)*B33)/(B33*DCOS(SIG1F))
    ELSE
        KQ=0.5D00*(KF+KH)+0.5D00*(B13**2+B23**2)/B33
        &      +B13*B23/(B33*DSIN(2.0D00*(+SIG1F)))
        KS= KQ-2.0D00*B13*B23/(B33*DSIN(2.0D00*(+SIG1F)))
    ENDIF
    SIGSF=-SIG1F
C....PRINCIPAL DIRECTIONS OF THE GENERATED SURFACE
    DO 2 I=1,3
        EQ(I)= DCOS(SIGSF)*EH(I)-DSIN(SIGSF)*EF(I)
2    ES(I)= DSIN(SIGSF)*EH(I)+DCOS(SIGSF)*EF(I)
        IF (KK .LT. 2) GO TO 100
        Q3=ES(1)*ET(1)+ES(2)*ET(2)+ES(3)*ET(3)
        Q4=EQ(1)*ET(1)+EQ(2)*ET(2)+EQ(3)*ET(3)
        IF(Q3.EQ.Q4) THEN
            Q34=DATAN(Q4)
        ELSE
            Q34=DATAN2(Q4,Q3)
        ENDIF

```

```

KT2=KS*DCOS(Q34)**2+KQ*DSIN(Q34)**2
KM2=KS*DSIN(Q34)**2+KQ*DCOS(Q34)**2
GO TO 120
100 KFF=KS
    KHH=KQ
120 RETURN
    END
C
C .... COMPUTE THE DIMENSIONS AND DIRECTIONS OF THE CONTACT ELLIPSE
C
    SUBROUTINE ELLIP
    IMPLICIT REAL*8(A-H,O-Z)
    REAL*8 KSIG1,KSIG2,KFF,KHH,KS,KQ
    COMMON /A300/ ES(3),EQ(3)
    COMMON /A380/ KS,KQ
    COMMON /A310/ KFF,KHH
    COMMON /A340/ EFF(3),EHH(3)
    COMMON /A360/ A,B,SI(3),FI(3)
    DEL=0.007D0
    PI=DACOS(-1.D0)
    S1=ES(1)*EFF(1)+ES(2)*EFF(2)+ES(3)*EFF(3)
    S2=EQ(1)*EFF(1)+EQ(2)*EFF(2)+EQ(3)*EFF(3)
    SIGSF=DATAN2(S2,S1)
C....COMPUTE THE DIMENSIONS OF THE CONTACT ELLIPSE (A & B)
    KSIG1=KFF+KHH
    KSIG2=KS+KQ
    G1=KFF-KHH
    G2=KS-KQ
    A=(KSIG1-KSIG2-(G1**2-2.D0*G1*G2*DCOS(2.D0*SIGSF)+G2**2)**0.5)
    & /4.D0
    B=(KSIG1-KSIG2+(G1**2-2.D0*G1*G2*DCOS(2.D0*SIGSF)+G2**2)**0.5)
    & /4.D0
    A=(DEL/ABS(A))**0.5
    B=(DEL/ABS(B))**0.5
C....COMPUTE THE ANGLE (ALF1) BETWEEN AXES OF ELLIPSE & PRINCIPLE
    S1=G2*DSIN(2.D0*SIGSF)
    S2=G1-G2*DCOS(2.D0*SIGSF)
    ALF1=0.5D0*DATAN2(S1,S2)
    S3=DSQRT(G1**2-2.D0*G1*G2*DCOS(2.D0*SIGSF)+G2**2)
    SS2=S1/S3
    SC2=S2/S3
    ALF1=DATAN(SS2/(1.D0+SC2))
    ALF1=DABS(ALF1)
C.. AXES OF THE CONTACT ELLIPSE
    DO 100 I=1,3
        SI(I)=DSIN(ALF1)*EFF(I)+DCOS(ALF1)*EHH(I)
        FI(I)=DCOS(ALF1)*EFF(I)-DSIN(ALF1)*EHH(I)
100 CONTINUE
    RETURN
    END

```

REPORT DOCUMENTATION PAGE			Form Approved OMB No. 0704-0188	
Public reporting burden for this collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to Washington Headquarters Services, Directorate for Information Operations and Reports, 1215 Jefferson Davis Highway, Suite 1204, Arlington, VA 22202-4302, and to the Office of Management and Budget, Paperwork Reduction Project (0704-0188), Washington, DC 20503.				
1. AGENCY USE ONLY (Leave blank)	2. REPORT DATE January 1995	3. REPORT TYPE AND DATES COVERED Final Contractor Report		
4. TITLE AND SUBTITLE Generation and Computerized Simulation of Meshing and Contact of Modified Involute Helical Gears		5. FUNDING NUMBERS WU-505-62-36 1L162211A47A		
6. AUTHOR(S) Faydor L. Litvin, Ningxin Chen, and Jian Lu				
7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES) University of Illinois at Chicago Chicago, Illinois 60607		8. PERFORMING ORGANIZATION REPORT NUMBER E-9410		
9. SPONSORING/MONITORING AGENCY NAME(S) AND ADDRESS(ES) Vehicle Propulsion Directorate U.S. Army Research Laboratory Cleveland, Ohio 44135-3191 and NASA Lewis Research Center Cleveland, Ohio 44135-3191		10. SPONSORING/MONITORING AGENCY REPORT NUMBER NASA CR-4644 ARL-CR-221		
11. SUPPLEMENTARY NOTES Project manager, Robert F. Handschuh, Vehicle Propulsion Directorate, U.S. Army Research Laboratory, NASA Lewis Research Center, organization code 0300, (216) 433-3969.				
12a. DISTRIBUTION/AVAILABILITY STATEMENT Unclassified - Unlimited Subject Category 37 This publication is available from the NASA Center for Aerospace Information, (301) 621-0390.		12b. DISTRIBUTION CODE		
13. ABSTRACT (Maximum 200 words) The design and generation of modified involute helical gears that have a localized and stable bearing contact, and reduced noise and vibration characteristics are described. The localization of the bearing contact is achieved by the mismatch of the two generating surfaces that are used for generation of the pinion and the gear. The reduction of noise and vibration will be achieved by application of a parabolic function of transmission errors that is able to absorb the almost linear function of transmission errors caused by gear misalignment. The meshing and contact of misaligned gear drives can be analyzed by application of computer programs that have been developed. The computations confirmed the effectiveness of the proposed modification of the gear geometry. A numerical example that illustrates the developed theory is provided.				
14. SUBJECT TERMS Gears; Gearteeth; Transmissions		15. NUMBER OF PAGES 76		
		16. PRICE CODE A05		
17. SECURITY CLASSIFICATION OF REPORT Unclassified	18. SECURITY CLASSIFICATION OF THIS PAGE Unclassified	19. SECURITY CLASSIFICATION OF ABSTRACT	20. LIMITATION OF ABSTRACT	